





BULKHEAD JACK PANEL SEAL SOLDER TYPE CABLE.085


PAGE 1/3 ISSUE 25-09-17A SERIES NEX10 PART NUMBER R180301007

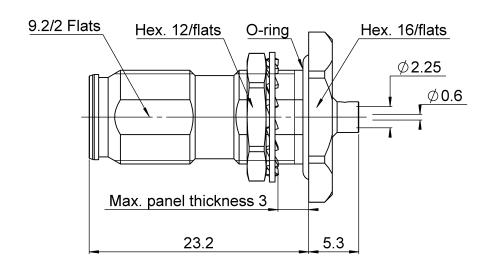


PANEL CUT OUT



	mm	
	Maxi	mini
A	10.1	10
В	9.3	9.2



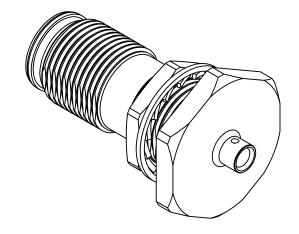

All dimensions are in mm.



COMPONENTS	MATERIALS	PLATING (μm)
D 1	PP.400	
Body	BRASS.	BBR
Center contact	BERYLLIUM COPPER	SILVER
Outer contact		
Insulator	PTFE	
Gasket	SILICONE RUBBER	
Others parts	BRASS/BRONZE	BBR
-	-	-
-	-	-



Technical Data Sheet

BULKHEAD JACK PANEL SEAL SOLDER TYPE CABLE.085

PAGE **2/3** ISSUE **25-09-17A** SERIES NEX10 PART NUMBER R180301007

PACKAGING

50	Contact us	Contact us
Standard	Unit	Other

ELECTRICAL CHARACTERISTICS

Impedance 50 Frequency 0-20 GHz **VSWR** 1.02 0.0200 x F(GHz) Maxi √F(GHz) dB Maxi Insertion loss 0.05 RF leakage NA - F(GHz)) dB Maxi - (Voltage rating Veff Maxi 500 Dielectric withstanding voltage 1500 Veff mini Insulation resistance 5000 $M\Omega$ mini

MECHANICAL CHARACTERISTICS

Center contact retention

Axial force - Mating End NA N mini Axial force - Opposite end NA N mini N.cm mini NA Torque

Recommended torque

NA Mating N.cm Panel nut 250 N.cm Clamp nut N.cm NA A/F clamp nut 0.0000 mm

Mating life 100 Cycles mini 14.5800 g

Weight

ENVIRONMENTAL

Operating temperature -55~+125 °C Hermetic seal NA Atm.cm3/s Panel leakage **IP67**

SPECIFICATION

CABLE ASSEMBLY

Stripping	а	b	С	d	е	f
mm	4	0	0	0	0	0

Assembly instruction: See page 3

Recommended cable(s)

BELN 1671A RG 405

Characteristics indicated on this data sheet are those that can be achieved with the highest performance cable. Intrinsic limitations of the cable may diminish the performance of the

Cable retention

- pull off 200 N mini - torque NA N.cm

TOOLING

Part Number	Description	Hexagon

OTHER CHARACTERISTICS

Interface: IP68(1m,24h) mated condition Intermodulation: <=-123dBm, 2x20W







BULKHEAD JACK PANEL SEAL SOLDER TYPE CABLE.085

PAGE 3/3 ISSUE 25-09-17A SERIES NEX10 PART NUMBER R180301007


COMPONENTS

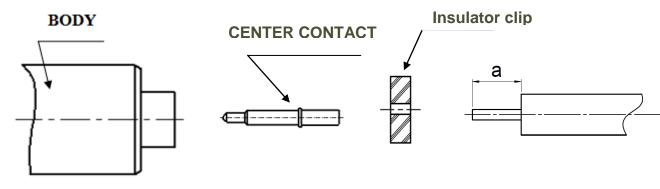

- 1
 - -Strip the cable with the cable stripping tool.
 - -Clean the cable



- 2
 - -Insert insulator clip on the cable
 - -Insert center contact until the insulator clip.
 - -Solder center contact



- 3
 - -Introduce the cable into the body until contact with the body shoulder.
 - -Place the sub-assembly on assembly jig
 - -Solder body on the cable.
 - -Let assembly cool down before removing it from the jig.

