# FXPQ3115BVS I<sup>2</sup>C precision pressure sensor with altimetry

Rev. 1.4 — 17 May 2024

Product data sheet



# 1 General description

The FXPQ3115BVS is a compact, piezoresistive, absolute pressure sensor with an I<sup>2</sup>C digital interface. FXPQ3115BVS has a wide operating range of 20 kPa to 110 kPa. This sensor is ideal for inhalers, continuous positive airway pressure (CPAP) masks, or other medical devices coming in contact with a patient's airway. The MEMS and ASIC die are coated with a biomedically approved gel. The gel is a nontoxic, nonallergenic elastomer which meets all United States Pharmacopeia (USP) biological testing class VI requirements. The gel properties allow uniform pressure transmission to the MEMS diaphragm.

A high-resolution ADC provides fully compensated and digitized outputs for pressure in Pascals and temperature in °C. The compensated output is available as either barometric pressure in Pascals or as an altitude in meters. The internal processing in FXPQ3115BVS removes compensation and unit conversion load from the system MCU, simplifying system design.

FXPQ3115BVS's advanced ASIC has multiple user programmable modes such as power saving, interrupt and autonomous data acquisition modes, including programmed acquisition cycle timing, and poll-only modes. Typical active supply current is 40 µA per measurement-second.

# 2 Features and benefits

- Operating range: 20 kPa to 110 kPa absolute pressure
- Calibrated range: 50 kPa to 110 kPa absolute pressure
- Calibrated temperature output: -40 °C to 85 °C
- I<sup>2</sup>C digital output interface
- Fully compensated internally
- Precision ADC resulting in 1.5 Pa of effective resolution
- Direct reading
  - Pressure: 20-bit measurement (Pascals)
    - 20 kPa to 110 kPa
  - Temperature: 12-bit measurement (°C)
  - –40 °C to 85 °C

- Programmable interrupts
- Autonomous data acquisition
  - Embedded 32-sample FIFO
  - Data logging up to 12 days using the FIFO
  - One-second to nine-hour data acquisition rate
- 1.95 V to 3.6 V supply voltage, internally regulated
- 1.6 V to 3.6 V digital interface supply voltage
- Operating temperature from -40 °C to +85 °C



# I<sup>2</sup>C precision pressure sensor with altimetry

# 3 Applications


- Inhalers/nebulizers
- Medical tablets
- Health activity monitors
- Oxygen concentrators
- CPAP machine and mask
- Spyrometry

# 4 Ordering information

#### Table 1. Ordering information

Device number	Shipping	Package	Nun	nber of p	orts		Pressure Ty	ре	Digital
			None	Single	Dual	Gauge	Differential	Absolute	interface
FXPQ3115BVST1	Tape and reel	98ASA002260D	•	_	_	—	_	•	•


# 5 Block diagram

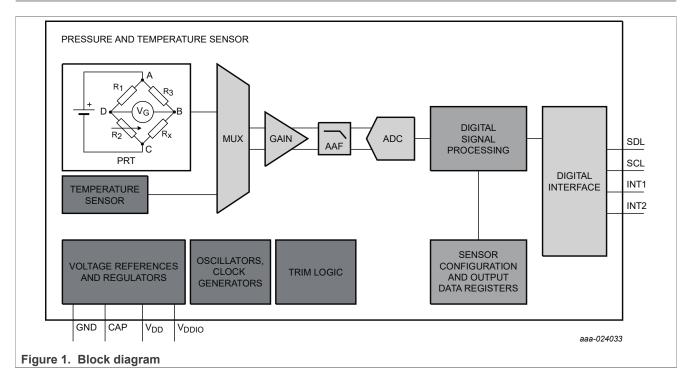

I<sup>2</sup>C precision pressure sensor with altimetry

# 6 Pinning information

# 6.1 Pinning

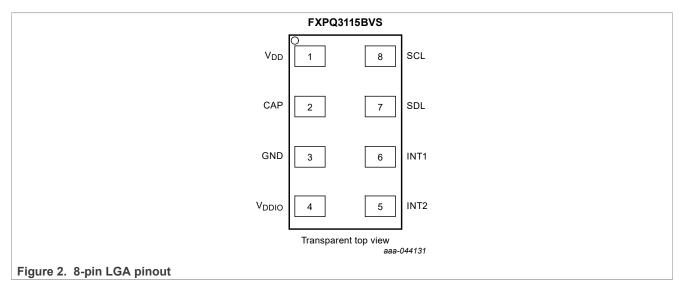


# 6.2 Pin description

### Table 2. Pin description

Symbol	Pin	Description	
V <sub>DD</sub>	1	V <sub>DD</sub> power supply connection (1.95 V to 3.6 V)	
CAP	2	External capacitor	
GND	3	Ground	
V <sub>DDIO</sub>	4	Digital interface power supply (1.62 V to 3.6 V)	
INT2	5	Pressure interrupt 2	
INT1	6	Pressure interrupt 1	
SDL	7	I <sup>2</sup> C serial data	
SCL	8	I <sup>2</sup> C serial clock	

I<sup>2</sup>C precision pressure sensor with altimetry

# 7 System connections

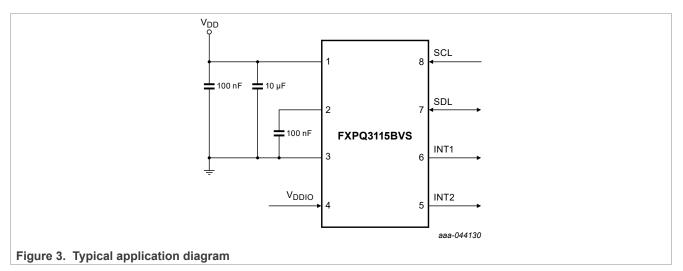

The device power is supplied through the  $V_{DD}$  line. Power supply decoupling capacitors (100 nF ceramic plus 10 µF bulk or 10 µF ceramic) should be placed as near as possible to pin 1 of the device. A second 100 nF capacitor is used to bypass the internal regulator. The functions, threshold, and the timing of the interrupt pins (INT1 and INT2) are user programmable through the I<sup>2</sup>C interface.

# 8 Handling and board mount recommendations

The sensor die is sensitive to light exposure. Direct light exposure through the port hole can lead to varied accuracy of pressure measurement. Avoid such exposure to the port during normal operation.

# 8.1 Methods of handling

Components can be picked from the carrier tape using either the vacuum assist or the mechanical type pickup heads. A vacuum assist nozzle type is most common due to its lower cost of maintenance and ease of operation. The recommended vacuum nozzle configuration should be designed to make contact with the device directly on the metal cover and avoid vacuum port location directly over the vent hole in the metal cover of the device. Multiple vacuum ports within the nozzle may be required to effectively handle the device and prevent shifting during movement to placement position.

Vacuum pressure required to adequately support the component should be approximately 25 in Hg (85 kPa). This level is typical of in-house vacuum supply. Pickup nozzles are available in various sizes and configurations to suit a variety of component geometries. To select the nozzle best suited for the specific application, NXP recommends that the customer consult their pick and place equipment supplier to determine the correct nozzle. In some cases it may be necessary to fabricate a special nozzle depending on the equipment and speed of operation.

Tweezers or other mechanical forms of handling that have a sharp point are not recommended since they can inadvertently be inserted into the vent hole of the device. This can lead to a puncture of the MEMS element that will render the device inoperable.

# 8.2 Board mount recommendations

Components can be mounted using solder paste stencil, screen printed or dispensed onto the PCB pads prior to placement of the component. The volume of solder paste applied to the PCB is normally sufficient to secure

### I<sup>2</sup>C precision pressure sensor with altimetry

the component during transport to the subsequent reflow soldering process. Use of adhesives to secure the component is not recommended, but where necessary can be applied to the underside of the device.

Solder pastes are available in variety of metal compositions, particle size, and flux types. The solder paste consists of metals and flux required for a reliable connection between the component lead and the PCB pad. Flux aids the removal of oxides that may be present on PCB pads and prevents further oxidation from occurring during the solder process.

The use of a No-Clean (NC) flux is recommended for exposed cavity components. Using pressure spray, wire brush, or other methods of cleaning is not recommended since it can puncture the MEMS device and render it unusable. If cleaning of the PCB is performed, Water Soluble (WS) flux can be used. However, it is recommended the component cavity is protected by adhesive Kapton tape, vinyl cap, or other means prior to the cleaning process. This covering prevents damage to the MEMS device, contamination, and foreign materials from being introduced into device cavity as result of cleaning processes.

Ultrasonic cleaning is not recommended as the frequencies can damage wire bond interconnections and the MEMS device.

# 9 Mechanical and electrical specifications

## 9.1 Terminology

#### 9.1.1 Resolution

The resolution of a pressure sensor is the minimum change of pressure that can be reliably measured. The usable resolution of the device is programmable, enabling the user to choose a compromise between acquisition speed, power consumption, and resolution that best fits the application. To simplify the programming, the data is always reported in the same format with differing number of usable bits.

#### 9.1.2 Accuracy

#### 9.1.2.1 Offset

The offset is defined as the output signal obtained when the reference pressure (a vacuum for an absolute pressure sensor) is applied to the sensor. Offset error affects absolute pressure measurements but not relative pressure measurements. An altitude measurement is the pressure value in comparison to sea level, a barometric measurement is the pressure value read by the sensor. That is, a measurement of total pressure seen (for example 70 kPa), or total height (for example 3000 m) above sea level. A change in the offset affects the pressure value or height seen above sea level as it shifts the sea level base reference. An absolute pressure measurement is not the same as relative pressure measurement, where the pressure is compared when raising or lowering pressure in shorter intervals. This would be a walk up a hill, measuring the pressure and altitude difference from start to finish. In the relative case, the offset shifts are shared in the two absolute measurements and negate each other during the pressure calculation.

For the FXPQ3115BVS, the long term offset shift can be removed by adjusting the pressure or altitude offset correction. See <u>Section 14.23 "Offset correction registers"</u>. This adjustment is provided to override the factory programmed values to compensate for offsets introduced by manufacturing and mounting stresses. NXP highly recommends using this adjustment to realize the full accuracy potential of the device.

### 9.1.2.2 Linearity

Linearity compares the slope of the measurement data to that of an ideal transfer function. It refers to how well the transducer output follows the equation  $P_{OUT} = P_{OFF}$  + sensitivity × P straight-line equation over the

### I<sup>2</sup>C precision pressure sensor with altimetry

operating pressure range. The method used by NXP to give the linearity specification is the end-point straightline method measured at midrange pressure.

#### 9.1.2.3 Absolute pressure

Absolute pressure sensors measure an external pressure relative to a zero-pressure reference (vacuum) sealed inside the reference chamber of the die during manufacturing. This standard allows comparison to a standard value set such that 14.7 psi = 101,325 Pa = 1 atm at sea level as a measurement target. The absolute pressure is used to determine altitude as it has a constant reference for comparison. Measurement at sea level can be compared to measurement at a mountain summit as they use the same vacuum reference. The conversion of absolute pressure to altitude in meters is calculated based on US Standard Atmosphere 1976 (NASA).

**Note:** Absolute pressure is not linear in relation to altitude, it is an exponential function. The value of altitude can be read directly from the device in increments of 0.0625 meters, or the value of pressure in 0.25 Pascal (Pa) units.

#### 9.1.2.4 Span

Span is the value of full-scale output with offset subtracted, representing the full range of the pressure sensor. Ideally the span is a specification over a constant temperature. The device uses internal temperature compensation to remove drift. Span accuracy is the comparison of the measured difference and the actual difference between the highest and lowest pressures in the specified range.

#### 9.1.3 Pressure/altitude

The device is a high accuracy pressure sensor with integrated data calculation and logging capabilities. To provide altitude readings, the altitude calculations are based on the measured pressure (p), the user input of the equivalent sea level pressure to compensate for local weather conditions (OFF\_H) and the US Standard Atmosphere 1976 (NASA). Pressure is given in Pascals (Pa), and fractions of a Pa. Altitude is given in meters (m) and fractions of a meter. The altitude is calculated from the pressure using the following equation:

$$h = 44330.77 \left\{ 1 - \left(\frac{p}{p_0}\right)^{0.1902632} \right\} + OFF_H (Register value)$$

Where:

 $p_0$  = sea level pressure (101,326 Pa) h = altitude in meters

### 9.2 Absolute maximum ratings

Absolute maximum ratings are the limits the device can be exposed to without permanently damaging it. Absolute maximum ratings are stress ratings only, functional operation at these ratings is not guaranteed. Exposure to absolute maximum ratings conditions for extended periods may affect device reliability.

This device contains circuitry to protect against damage due to high static voltage or electrical fields. It is advised, however, that normal precautions be taken to avoid application of any voltages higher than maximum-rated voltages to this high-impedance circuit.

### I<sup>2</sup>C precision pressure sensor with altimetry

#### Table 3. Maximum ratings Characteristic Value Unit Symbol 500 $\mathsf{P}_{\mathsf{max}}$ Maximum applied pressure kPa -0.3 to 3.6 V $V_{DD}$ Supply voltage -0.3 to 3.6 V V<sub>DDIO</sub> Interface supply voltage $V_{IN}$ Input voltage on any control pin (SCL, SDA) -0.3 to V<sub>DDIO</sub> + 0.3 V Operating temperature range -40 to +85 °C T<sub>OP</sub> Storage temperature range -40 to +125 °C T<sub>STG</sub>

#### Table 4. ESD and latchup protection characteristics

Symbol	Rating	Value	Unit
HBM	Human body model	±2000	V
CDM	Charge device model	±500	V
	Latchup current at T = 85 °C	±100	mA



Caution
This device is sensitive to mechanical shock. Improper handling can cause permanent damage to the part or cause the part to otherwise fail.



Caution
This device is sensitive to ElectroStatic Discharge (ESD). Observe precautions for handling electrostatic sensitive devices.

Such precautions are described in the ANSI/ESD S20.20, IEC/ST 61340-5, JESD625-A, or equivalent standards.

### 9.3 Mechanical characteristics

#### Table 5. Mechanical characteristics

 $V_{DD}$  = 2.5 V, T = 25 °C, over 50 kPa to 110 kPa, unless otherwise noted.

Symbol	Parameter	Test conditions	Min	Тур	Мах	Unit
Pressure sen	sor					
P <sub>FS</sub>	Measurement range	Calibrated range	50		110	kPa
		Operational range	20		110	kPa
	Pressure reading noise <sup>[1]</sup>	1x oversample		19		Pa RMS
		128x oversample		1.5		Pa RMS
	Pressure absolute accuracy	50 kPa to 110 kPa over 0 °C to 50 °C	-0.75	—	0.75	kPa
		50 kPa to 110 kPa over −10 °C to 70 °C		±0.75		kPa

7 / 49

© 2024 NXP B.V. All rights reserved.

# I<sup>2</sup>C precision pressure sensor with altimetry

## Table 5. Mechanical characteristics...continued

V<sub>DD</sub> = 2.5 V, T = 25 °C, over 50 kPa to 110 kPa, unless otherwise noted.

Symbol	Parameter	Test conditions	Min	Тур	Max	Unit
	Pressure relative accuracy	Relative accuracy during pressure change between 70 kPa to 110 kPa at any constant temperature between -10 °C to 50 °C	_	±0.05		kPa
		Relative accuracy during changing temperature between -10 °C to 50 °C at any constant pressure between 50 kPa to 110 kPa	_	±0.1		kPa
	Pressure/altitude resolution	Barometer mode	0.25	1.5		Pa
	[2] [3] [4]	Altimeter mode	0.0625	0.3		m
	Output data rate	One-shot mode		100		Hz
		FIFO mode			1	Hz
	Board mount drift	After solder reflow	-0.45	±0.15	0.45	kPa
	Long-term drift	After a period of 1 year	-0.3	±0.1	0.3	kPa
Temperature	e sensor		1	1		
T <sub>FS</sub>	Measurement range		-40		+85	°C
	Temperature accuracy	@25 °C		±1		°C
		Over temperature range		±3		°C
T <sub>OP</sub>	Operating temperature range		-40		+85	°C

Oversample (OSR) modes internally combine and average samples to reduce noise. [1]

Smallest bit change in register represents minimum value change in Pascals or meters. Typical resolution to signify change in altitude is 0.3 m. Reference pressure = 101.325 kPa (sea level). [2] [3] [4]

At 128x oversample ratio.

# 9.4 Electrical characteristics

#### Table 6. Electrical characteristics

@  $V_{DD}$  = 2.5 V, T = 25 °C unless otherwise noted.

Symbol	Parameter	Test conditions	Min	Тур	Max	Unit
V <sub>DDIO</sub>	I/O supply voltage	—	1.62	1.8	3.6	V
V <sub>DD</sub>	Operating supply voltage	—	1.95	2.5	3.6	V
I <sub>DD</sub>	Integrated current 1 update per second	Highest speed mode oversample = 1	_	8.5	—	μA
		Standard mode oversample = 16	_	40	—	μA
		High-resolution mode oversample = 128	_	265	_	μA
I <sub>DDMAX</sub>	Max current during acquisition and conversion	During acquisition/ conversion	_	2	_	mA

# I<sup>2</sup>C precision pressure sensor with altimetry

Symbol	Parameter	Test conditions	Min	Тур	Max	Unit
IDDSTBY	Supply current drain in STANDBY mode	STANDBY mode selected SBYB = 0	-	2	_	μA
VIH	Digital high-level input voltage SCL, SDA	_	0.75	_	_	V <sub>DDIO</sub>
VIL	Digital low-level input voltage SCL, SDA	—	_		0.3	V <sub>DDIO</sub>
VOH	High-level output voltage INT1, INT2	I <sub>O</sub> = 500 μA	0.9		_	V <sub>DDIO</sub>
VOL	Low-level output voltage INT1, INT2	I <sub>O</sub> = 500 μA	_		0.1	V <sub>DDIO</sub>
VOLS	Low-level output voltage SDA	I <sub>O</sub> = 500 μA	_		0.1	V <sub>DDIO</sub>
T <sub>ON</sub>	Turn-on time <sup>[1][2][3]</sup>	High-speed mode	_	—	60	ms
		High-resolution mode	_	_	1000	ms
T <sub>OP</sub>	Operating temperature range	—	-40	25	+85	°C
I <sup>2</sup> C addressing	3	I	1			
I <sup>2</sup> C Address	_	_		0x60		Hex

# Table 6. Electrical characteristics...continued

@  $V_{DD}$  = 2.5 V, T = 25 °C unless otherwise noted.

[1] Time to obtain valid data from STANDBY mode to ACTIVE mode

to 60h or 110 0000. 8-bit read is C1h, 8-bit write is C0h.

High-speed mode is achieved by setting the oversample rate of 1x.

[2] [3] High-resolution mode is achieved by setting the oversample to 128x.

#### **Digital interface** 10

The registers embedded inside the device are accessed through an  $I^2C$  serial interface.

#### Table 7. Serial interface pin descriptions

Name	Description
SCL	I <sup>2</sup> C serial clock
SDA	I <sup>2</sup> C serial data

# 10.1 I<sup>2</sup>C characteristics

Table 8. I<sup>2</sup>C client timing values

All values referred to VIH(min) and VIL(max) levels.

Symbol	Parameter	I <sup>2</sup> C	I <sup>2</sup> C					
		Condition	Min	Max				
f <sub>SCL</sub>	SCL clock frequency	Pull-up = 1 kΩ, Cb = 400 pF	0	400	kHz			
f <sub>SCL</sub>	SCL clock frequency	Pull-up = 1 k $\Omega$ , Cb = 20 pF	0	4	MHz			

© 2024 NXP B.V. All rights reserved.

### I<sup>2</sup>C precision pressure sensor with altimetry

Symbol	Parameter	l <sup>2</sup> C	I <sup>2</sup> C		Unit
		Condition	Min	Max	-
t <sub>BUF</sub>	Bus free time between STOP and START condition	_	1.3	_	μs
t <sub>HD;STA</sub>	Repeated START hold time	_	0.6		μs
t <sub>SU;STA</sub>	Repeated START setup time	—	0.6		μs
t <sub>SU;STO</sub>	STOP condition setup time	—	0.6	—	μs
t <sub>HD;DAT</sub>	SDA data hold time <sup>[1][2][3]</sup>	_	50	_	ns
t <sub>SU;DAT</sub>	SDA setup time <sup>[4]</sup>	_	100	_	ns
t <sub>LOW</sub>	SCL clock low time	_	1.3	—	μs
t <sub>HIGH</sub>	SCL clock high time	_	0.6		μs
t <sub>r</sub>	SDA and SCL risetime <sup>[5]</sup>	_	20 + 0.1C <sub>b</sub>	300	ns
t <sub>f</sub>	SDA and SCL fall Time <sup>[2][5][6][7]</sup>	_	20+ 0.1C <sub>b</sub>	300	ns
t <sub>SP</sub>	Pulse width of spikes that are suppressed by internal input filter	_	_	50	ns

# Table 8. I<sup>2</sup>C client timing values...continued All values referred to VIH(min) and VIL(max) levels.

[1] t<sub>HD:DAT</sub> is the data hold time that is measured from the falling edge of SCL, applies to data in transmission and the acknowledge.

[2] The device must internally provide a hold time of at least 300 ns for the SDA signal (with respect to the VIH(min) of the SCL signal) to bridge the undefined region of the falling edge of SCL

[3] The maximum  $t_{HD;DAT}$  must be less than the maximum of  $t_{VD;DAT}$  or  $t_{VD;ACK}$  by a transition time. This device does not stretch the LOW period ( $t_{LOW}$ ) of the SCL signal.

[4] A fast mode I<sup>2</sup>C device can be used in a standard mode I<sup>2</sup>C system, but the requirement t<sub>SU;DAT</sub> 250 ns must then be met. This is automatically the case if the device does not stretch the LOW period of the SCL signal. If such a device does stretch the LOW period of the SCL signal, it must output the next data bit to the SDA line t<sub>f</sub>(max) + t<sub>SU;DAT</sub> = 1000 + 250 = 1250 ns (according to the standard mode I<sup>2</sup>C specification) before the SCL line is released. Also the acknowledge timing must meet this set-up time.

[5] Cb = Total capacitance of one bus line in pF.

[6] The maximum t<sub>f</sub> for the SDA and SCL bus lines is specified at 300 ns. The maximum fall time for the SDA output stage t<sub>f</sub> is specified at 250 ns. This allows series protection resistors to be connected in between the SDA and the SCL pins and the SDA/SCL bus lines without exceeding the maximum specified t<sub>f</sub>.

[7] In fast mode plus, fall time is specified the same for both output stage and bus timing. If series resistors are used, designers should allow for this when considering bus timing.


# 10.2 I<sup>2</sup>C operation

The transaction on the bus is started through a start condition (START) signal. START condition is defined as a HIGH to LOW transition on the data line while the SCL line is held HIGH. After START has been transmitted by the host, the bus is considered busy. The next byte of data transmitted after START contains the client address in the first 7 bits, and the eighth bit tells whether the host is receiving data from the client or transmitting data to the client. When an address is sent, each device in the system compares the first 7 bits after a start condition with its address. If they match, the device considers itself addressed by the host. The ninth clock pulse, following the client address byte (and each subsequent byte) is the acknowledge (ACK). The transmitter must release the SDA line during the ACK period. The receiver must then pull the data line low so that it remains stable low during the high period of the acknowledge clock period.

The number of bytes per transfer is unlimited. If the host cannot receive another complete byte of data until it has performed some other function, it can hold the clock line, SCL low to force the transmitter into a wait state. Data transfer only continues when the host is ready for another byte and releases the clock line.

A low to high transition on the SDA line while the SCL line is high is defined as a stop condition (STOP). A data transfer is always terminated by a STOP. A host may also issue a repeated START during a data transfer. Device expects repeated STARTs to be used to randomly read from specific registers.

### I<sup>2</sup>C precision pressure sensor with altimetry

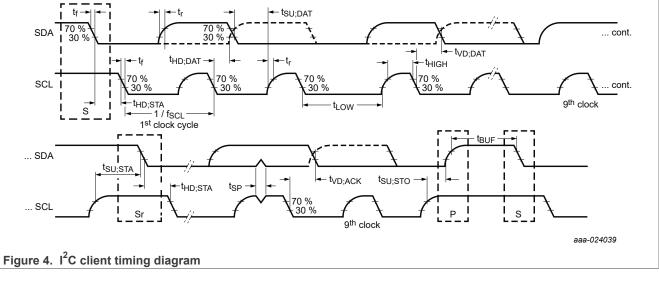

The device uses 7-bit addressing and does not acknowledge general call address 000 0000. The standard 7-bit  $I^2C$  client address is 60h or 110 0000. 8-bit read is C1h, 8-bit write is C0h.

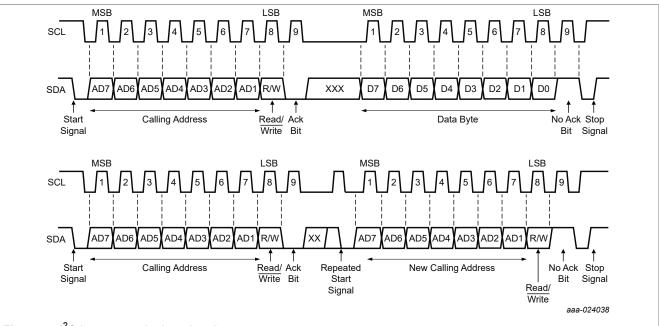


Figure 5. I<sup>2</sup>C bus transmission signals

Consult factory for alternate addresses. See the application note titled Sensor I<sup>2</sup>C Setup and FAQ (document AN4481).

I<sup>2</sup>C precision pressure sensor with altimetry

#### Modes of operation 11

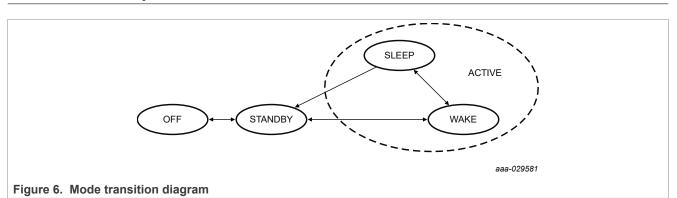


Table 9. Mode of operation description

Mode	I <sup>2</sup> C-bus state	V <sub>DD</sub>	Condition	Function description
OFF	Powered down	< 1.62 V	< V <sub>DD</sub> + 0.3 V	Device is powered off.
STANDBY	I <sup>2</sup> C/SPI communication with the device is possible	ON	SBYB bit of CTRL_REG1 is cleared	Only POR and digital blocks are enabled. Analog subsystem is disabled.
ACTIVE	I <sup>2</sup> C/SPI communication with the device is possible	ON	SBYB bit of CTRL_REG1 is set	All blocks are enabled (POR, digital, analog).

# 11.1 OFF

Unit is powered down and has no operating functionality.  $V_{DD}$  and  $V_{DDIO}$  are not powered.

### **11.2 STANDBY**

The digital sections are operational and the unit is capable of receiving commands and delivering stored data. The analog sections are off. The part is waiting for CTRL\_REG1 to be configured and the part to enter active mode.

# **11.3 ACTIVE**

Both analog and digital sections are running. The unit is capable of gathering new data, and accepting commands. The device is fully functional.

#### 12 Quick start setup

To set up the device in altimeter mode, you may select your data retrieval method between polling (no FIFO), interrupt (no FIFO) or with the FIFO. The flow charts in Figure 7 and Figure 8 describe the setup for polling or interrupt with an OSR of 128.


For more information, see application note titled Data Manipulation and Basic Settings of the MPL3115A2 Command Line Interface (document AN4519).

FXPQ3115BVS

# **NXP Semiconductors**

# FXPQ3115BVS


#### I<sup>2</sup>C precision pressure sensor with altimetry

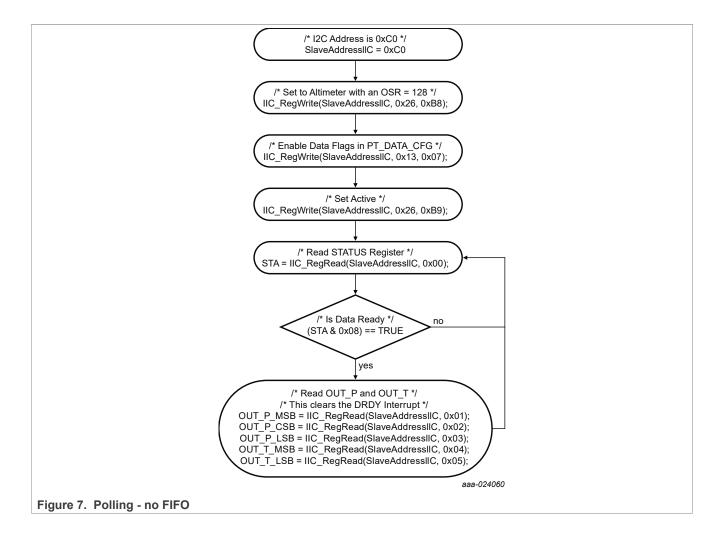

# **NXP Semiconductors**

# FXPQ3115BVS

### I<sup>2</sup>C precision pressure sensor with altimetry

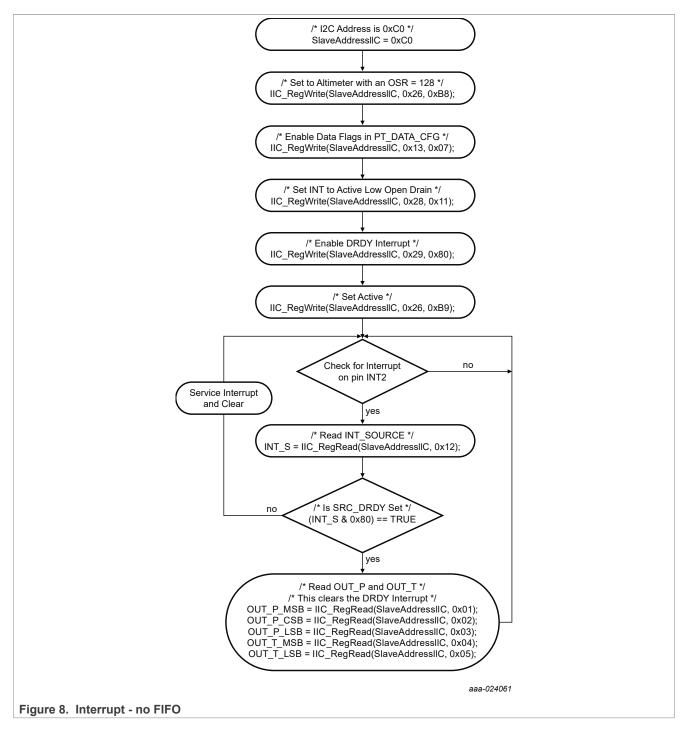

#### **Functionality** 13

The device is a low-power, high accuracy, digital output altimeter, barometer, and thermometer, packaged in a 3 x 5 x 1.1 mm form factor. The complete device includes a sensing element, analog and digital signal processing and an I<sup>2</sup>C interface.

The device has two operational modes, barometer and altimeter. Both modes include a thermometer temperature output function.

FXPQ3115BVS All information provided in this document is subject to legal disclaimers. Product data sheet Rev. 1.4 - 17 May 2024

© 2024 NXP B.V. All rights reserved.

14 / 49

### I<sup>2</sup>C precision pressure sensor with altimetry

Power consumption and sensitivity are programmable where the data oversampling ratio can be set to balance current consumption and noise/resolution. Serial interface communication is through an I<sup>2</sup>C interface therefore making the device particularly suitable for direct interfacing with a microcontroller. The device features two independently programmable interrupt signals INT1 and INT2. These can be set to generate an interrupt signal when a new set of pressure/altitude and temperature data is available, thereby simplifying data acquisition for the host controller. These interrupt pins can also be configured to generate interrupts when a user programmed set of conditions are met (see Section 13.6 "External interrupts").

Examples are:

- interrupt can be triggered when a single new data acquisition is ready
- when a desired number of samples are stored within the internal FIFO
- when a change of pressure/altitude or temperature is detected.

### **13.1 Factory calibration**

The device is factory calibrated for sensitivity, offset for both temperature and pressure measurements. Trim values are stored on-chip, in non-volatile memory (NVM). In normal use, further calibration is not necessary. However, in order to realize the highest possible accuracy, the device allows the user to override the factory set offset values after power-up. The user adjustments are stored in volatile registers. The factory calibration values are not affected, and are always used by default on power-up.

### 13.2 Barometer/altimeter function

The mode of operation of the device can be selected as barometer or altimeter. The internal sensor gives an absolute pressure signal. The absolute pressure signal is processed to provide a scaled pressure or an altitude, depending on the mode selected. The combination of a high performance sensor and the signal processing enable resolution of pressures below 1 Pa and altitude resolution of better than 1 m at sea level.

When in barometer mode, all pressure related data is reported as 20-bit unsigned data in Pascals. When in altimeter mode, all pressure data is converted to equivalent altitude, based on the US standard atmosphere and then stored as 20-bit 2's complement value in meters and fractions of a meter.

### **13.2.1 Barometric input**

In order to accurately determine the altitude by pressure, the OFF\_H register (see <u>Section 14.23.3 "OFF\_H</u>-<u>altitude data user offset register (address 2Dh)"</u>) is provided to input the local barometric pressure correction. The default value is 101,326 Pa since the BAR\_IN\_MSB and BAR\_IN\_LSB registers are in units of 2 Pascals per LSB.

### 13.3 Temperature function

The unit contains a high-resolution temperature sensor that provides data to the user via a 16-bit data register, as well as for internal compensation of the pressure sensor.

### 13.4 Autonomous data acquisition

The unit can be programmed to periodically capture pressure/altitude and temperature data. Up to 32 data acquisitions can be stored in the internal FIFO. The interval between acquisitions is programmable from one second to nine hours.

Data collection capabilities: (up to 32 samples over 12 days). The unit can also be programmed to make a single reading and then go to standby mode.

### I<sup>2</sup>C precision pressure sensor with altimetry

## 13.5 FIFO

A 32-sample FIFO is incorporated to minimize the overhead of collecting multiple data samples. The FIFO stores both temperature and pressure/altitude data. The device can be programmed to autonomously collect data at programmed intervals and store the data in the FIFO. FIFO interrupts can be triggered by watermark full or data contention (FIFO GATE) events.

## **13.6 External interrupts**

Two independent interrupt out pins are provided. The configuration of the pins is programmable (polarity, opendrain, or push/pull.) Any one of the internal interrupt sources can be routed to either pin.

### 13.6.1 Reach target threshold pressure/altitude (SRC\_PTH)

The interrupt flag is set on reaching the value stored in the pressure/altitude target register. Additionally, a window value provides the ability to signal when the target is nearing the value in the pressure/altitude target register from either above or below. When in barometer mode, these values represent pressures rather than altitudes.

#### Examples:

- Set altitude alert to 3000 m and window value to 100 m, interrupt is asserted passing 2900 m, 3000 m, and 3100 m.
- Set pressure alert to 100.0 kPa and window value to 5 kPa, interrupt can be sent passing 95 kPa, 100 kPa, and 105 kPa.

**Note:** When the window value is set to 0, then the interrupt will only be generated when reaching or crossing the target value.

#### 13.6.2 Reach window target pressure/altitude (SRC\_PW)

The interrupt flag is set when the pressure/altitude value is within the window defined by the following formula:

 $Window = P_T GT_{MSB,LSB} \pm P_W IND_{MSB,LSB}$ 

**Note:** If the P\_WND value is set to 0, no interrupt is generated.

#### 13.6.3 Reach target threshold temperature (SRC\_TTH)

Interrupt flag is set on reaching the value stored in the temperature target register. Additionally a window value provides ability to signal when the target is nearing from either above or below the value in the temperature target register.

**Note:** When the window value is set to 0, then the interrupt will only be generated when reaching or crossing the target value.

#### 13.6.4 Reach window target temperature (SRC\_TW)

The interrupt flag is set when the temperature value is within the window defined by the following formula:

 $Window = T_TGT \pm T_WIND$ 

*Note:* No interrupt is generated if the T\_WND value is set to 0.

#### I<sup>2</sup>C precision pressure sensor with altimetry

#### 13.6.5 Pressure/altitude change (SRC\_PCHG)

Interrupt flag is set if sequential pressure/altitude acquisitions exceed value stored in pressure/altitude window value register.

#### 13.6.6 Temperature change (SRC\_TCHG)

Interrupt flag is set if sequential temperature acquisitions exceed the value stored in pressure/altitude window value register.

#### 13.6.7 Data ready

Interrupt flag is set when new data or a data overwrite event has occurred. PTOW and/or PTDR (DR\_STATUS register) must be set for an interrupt to be generated.

#### 13.6.8 FIFO event

Interrupt flag is set when either an overflow or watermark event has occurred. For more information, see <u>Section 14.8 "FIFO setup registers"</u>.

#### 13.6.9 Pressure/altitude and temperature delta

Registers show the differences from the last pressure/altitude and temperature samples.

#### 13.6.10 Min/max data value storage

Registers record the minimum and maximum pressure/altitude and temperature.

# 14 Register descriptions

Register Address	Name	Access	Reset value	Description	Reset when STBY to Active	Comment	Auto-increment address				Reference
00h	STATUS	R	00h	Sensor status register <sup>[1]</sup> . <sup>[2]</sup>	Yes	Alias for DR_STATUS or F_ STATUS	01h		Section 14.1		
01h	OUT_P_MSB	R	00h	Pressure data out MSB <sup>[1][2]</sup>	Yes	Bits 12 to 19 of 20-bit real-time pressure sample. Root pointer to pressure and	02h	01h	Section 14.3		
						temperature FIFO data.					
02h	OUT_P_CSB	R	00h	Pressure data out CSB <sup>[1][2]</sup>	Yes	Bits 4 to 11 of 20-bit real-time pressure sample	03h		Section 14.3		
03h	OUT_P_LSB	R	00h	Pressure data out LSB <sup>[1][2]</sup>	Yes	Bits 0 to 3 of 20-bit real-time pressure sample	04h		Section 14.3		
04h	OUT_T_MSB	R	00h	Temperature data out MSB	Yes	Bits 4 to 11 of 12-bit real-time temperature sample	05h		Section 14.4		
05h	OUT_T_LSB	R	00h	Temperature data out LSB	Yes	Bits 0 to 3 of 12-bit real-time temperature sample	00h		Section 14.4		
06h/00h	DR_STATUS	R	00h	Sensor status register [1][2]	Yes	Data ready status information	07h		Section 14.2		
07h	OUT_P_DELTA_MSB	R	00h	Pressure data out delta MSB <sup>[1][2]</sup>	Yes	Bits 12 to 19 of 20-bit pressure change data	08h		Section 14.5		
08h	OUT_P_DELTA_CSB	R	00h	Pressure data out delta CSB	Yes	Bits 4 to 11 of 20-bit pressure change data	09h		Section 14.5		
09h	OUT_P_DELTA_LSB	R	00h	Pressure data out delta LSB [1][2]	Yes	Bits 0 to 3 of 20-bit pressure change data	0Ah		Section 14.5		
0Ah	OUT_T_DELTA_MSB	R	00h	Temperature data out delta MSB <sup>[1][2]</sup>	Yes	Bits 4 to 11 of 12-bit temperature change data	0Bh		Section 14.6		

FXPQ3115BVS Product data sheet

# I<sup>2</sup>C precision pressure sensor with altimetry

Table 10	. Register addres	ss map	.continu	ied				
Register Address	Name	Access	Reset value	Description	Reset when STBY to Active	Comment	Auto-increment address	Reference
0Bh	OUT_T_DELTA_LSB	R	00h	Temperature data out delta LSB <sup>[1][2]</sup>	Yes	Bits 0 to 3 of 12-bit temperature change data	06h	Section 14.6
0Ch	WHO_AM_I	R	C5h	Device identification register	No	Fixed device ID number	0Dh	Section 14.7
0Dh	F_STATUS	R	00h	FIFO status register <sup>[1][2]</sup>	Yes	FIFO status: no FIFO event detected	0Eh	Section 14.8.1
0Eh/01h	F_DATA	R	00h	FIFO 8-bit data access [1][2]	Yes	FIFO 8-bit data access	0Eh	Section 14.8.2
0Fh	F_SETUP	R/W	00h	FIFO setup register [1][3]	No	FIFO setup	10h	Section 14.8.3
10h	TIME_DLY	R	00h	Time delay register <sup>[1][2]</sup>	Yes	Time since FIFO overflow	11h	Section 14.9
11h	SYSMOD	R	00h	System mode register [2]	Yes	Current system mode	12h	Section 14.10
12h	INT_SOURCE	R	00h	Interrupt source register [1]	No	Interrupt status	13h	Section 14.11
13h	PT_DATA_CFG	R/W	00h	PT data configuration register	No	Data event flag configuration	14h	Section 14.12
14h	BAR_IN_MSB	R/W	C5h	BAR input in MSB <sup>[1][3]</sup>	calculation bits 8 to15		15h	Section 14.13
15h	BAR_IN_LSB	R/W	E7h	BAR input in LSB <sup>[1][3]</sup>	No	Barometric input for altitude calculation bits 0 to 7	16h	Section 14.13
16h	P_TGT_MSB	R/W	00h	Pressure target MSB <sup>[1][3]</sup>	No	Pressure/altitude target value bits 8 to 15	17h	Section 14.14
17h	P_TGT_LSB	R/W	00h	Pressure target LSB <sup>[1][3]</sup>	No	Pressure/altitude target value bits 0 to 7	18h	Section 14.14
18h	T_TGT	R/W	00h	Temperature target register	No	Temperature target value	19h	Section 14.15
19h	P_WND_MSB	R/W	00h	Pressure/altitude window MSB <sup>[1][3]</sup>	No	Pressure/altitude window value bits 8 to 15	1Ah	Section 14.16
1Ah	P_WND_LSB	R/W	00h	Pressure/altitude window LSB <sup>[1][3]</sup>	No	Pressure/altitude window value bits 0 to 7	1Bh	Section 14.16
1Bh	T_WND	R/W	00h	Temperature window register	No	Temperature window value	1Ch	Section 14.17
1Ch	P_MIN_MSB	R/W	00h	Minimum pressure data out MSB <sup>[1][3]</sup>	No	Minimum pressure/altitude bits 12 to 19	1Dh	Section 14.18
1Dh	P_MIN_CSB	R/W	00h	Minimum pressure data out CSB <sup>[1][3]</sup>	No	Minimum pressure/altitude bits 4 to 11	1Eh	Section 14.18
1Eh	P_MIN_LSB	R/W	00h	Minimum pressure data out LSB <sup>[1][3]</sup>	No	Minimum pressure/altitude bits 0 to 3	1Fh	Section 14.18
1Fh	T_MIN_MSB	R/W	00h	Minimum temperature data out MSB <sup>[1][3]</sup>	No	Minimum temperature bits 8 to15	20h	Section 14.20
20h	T_MIN_LSB	R/W	00h	Minimum temperature data out LSB <sup>[1][3]</sup>	No	Minimum temperature bits 0 to 7	21h	Section 14.20
21h	P_MAX_MSB	R/W	00h	Maximum pressure data out MSB <sup>[1][3]</sup>	No	Maximum pressure/altitude bits 12 to 19	22h	Section 14.19
22h	P_MAX_CSB	R/W	00h	Maximum pressure data out CSB <sup>[1][3]</sup>	No	Maximum pressure/altitude bits 4 to 11	23h	Section 14.19
23h	P_MAX_LSB	R/W	00h	Maximum pressure data out LSB <sup>[1][3]</sup>	No	Maximum pressure/altitude bits 0 to 3	24h	Section 14.19
24h	T_MAX_MSB	R/W	00h	Maximum temperature data out MSB <sup>[1][3]</sup>	No	Maximum temperature bits 8 to 15	25h	Section 14.21
25h	T_MAX_LSB	R/W	00h	Maximum temperature data out LSB <sup>[1][3]</sup>	No	Maximum temperature bits 0 to 7	26h	Section 14.21
26h	CTRL_REG1	R/W	00h	Control register 1 [1][4]	No	Modes, oversampling	27h	Section 14.22.1
27h	CTRL_REG2	R/W	00h	Control register 2 <sup>[1]</sup>	No	Acquisition time step	28h	Section 14.22.2
28h	CTRL_REG3	R/W	00h	Control register 3 <sup>[1][4]</sup>	No	Interrupt pin configuration	29h	Section 14.22.3
29h	CTRL_REG4	R/W	00h	Control register 4 [1][4]	No	Interrupt enables	2Ah	Section 14.22.4
2Ah	CTRL_REG5	R/W	00h	Control register 5 <sup>[1][4]</sup>	No	Interrupt output pin assignment	2Bh	Section 14.22.5
2Bh	OFF_P	R/W	00h	Pressure data user offset register	No	Pressure data offset	2Ch	Section 14.23
2Ch	OFF_T	R/W	00h	Temperature data user offset register	No	Temperature data offset	2Dh	Section 14.23.2
2Dh	OFF_H	R/W	00h	Altitude data user offset register	No	Altitude data offset	0Ch	Section 14.23.3

#### Table 10. Register address map...continued

FXPQ3115BVS

© 2024 NXP B.V. All rights reserved.

# I<sup>2</sup>C precision pressure sensor with altimetry

Register contents are preserved when transitioning from ACTIVE to STANDBY mode [1]

Register contents are reset when transitioning from STANDBY to ACTIVE mode. Register contents can be modified anytime in STANDBY or ACTIVE mode. [2]

[3] [4] Modification of this register's contents can only occur when device in STANDBY mode except the SBYB, OST, and RST bit fields in CTRL\_REG1 register.

Register Address	Name	Access	Reset value	Description	Reset when STBY to Active	Comment	Auto-incr addre		Reference
00h/06h	DR_STATUS <sup>[1]</sup>	R	00h	Sensor status register	Yes	DR_STATUS	01h		Section 14.2
01h	OUT_P_MSB <sup>[1]</sup>	R	00h	Pressure data out MSB	Yes	Bits12 to 19 of 20-bit real-time pressure sample. Root pointer to pressure and	02h 01h		Section 14.3
						temperature FIFO data.			
02h	OUT_P_CSB <sup>[1]</sup>	R	00h	Pressure data out CSB	Yes	Bits 4 to 11 of 20-bit real-time pressure sample	03h		Section 14.3
03h	OUT_P_LSB <sup>[1]</sup>	R	00h	Pressure data out LSB	Yes	Bits 0 to 3 of 20-bit real-time pressure sample	04h		Section 14.3
04h	OUT_T_MSB <sup>[1]</sup>	R	00h	Temperature data out MSB	Yes	Bits 4 to 11 of 12-bit real-time temperature sample	05h		Section 14.4
05h	OUT_T_LSB <sup>[1]</sup>	R	00h	Temperature data out LSB	Yes	Bits 0 to 3 of 12-bit real-time temperature sample	00h		Section 14.4

Table 11. Register address map: Area A (F\_Mode = 0, FIFO disabled)

The Registers in Area A from 00h to 05h depend on the F MODE bit setting in FIFO Setup Register (F SETUP). [1]

• F\_MODE = 00, FIFO is disabled.

• F MODE = 01 is circular buffer.

• F\_MODE = 10 is full stop mode.

Table 12. Register address map: Area A (F\_Mode > 0, FIFO in circular buffer or full stop mode)

Register Address	Name	Access	Reset value	Description	Reset when STBY to Active	Comment	Auto- increment address	Reference
00h/0Dh	F_STATUS <sup>[1]</sup>	R	00h	Sensor status register	Yes	F_STATUS	01h	Section 14.8.1
01h	F_DATA <sup>[1]</sup>	R	00h	FIFO 8-bit data access	Yes	-	01h	Section 14.8.2
02h	Read to reserved area returns 00 <sup>[1]</sup>	-	00h	_	n.a.	_	03h	-
03h	Read to reserved area returns 00 <sup>[1]</sup>	-	00h	_	n.a.	_	04h	-
04h	Read to reserved area returns 00 <sup>[1]</sup>	-	00h	-	n.a.	_	05h	-
05h	Read to reserved area returns 00 <sup>[1]</sup>	-	00h	_	n.a.	_	00h	-

The registers in area A from 00h to 05h depend on the F MODE bit setting in FIFO setup register (F SETUP). [1]

• F\_MODE = 00, FIFO is disabled.

• F MODE = 01 is circular buffer.

• F\_MODE = 10 is full stop mode.

# 14.1 STATUS - sensor status register (address 00h)

The aliases allow the STATUS register to be read easily before reading the current pressure/altitude or temperature data, the delta pressure/altitude or temperature data, or the FIFO data, using the register address auto-incrementing mechanism.

# I<sup>2</sup>C precision pressure sensor with altimetry

FIFO data enabled mode bit setting	Status register alias
F_MODE = 00 <sup>[1]</sup>	00h = DR_STATUS (06h)
F_MODE >00	00h = F_STATUS (0Dh)

#### Table 13. Alias for DR\_Status (06h) or F\_Status (0Dh) registers

[1] The F\_MODE is defined in <u>Section 14.8.3 " F\_SETUP- FIFO setup register (address 0Fh)"</u>

# 14.2 DR\_STATUS - status register (address 06h)

The DR\_STATUS register provides the acquisition status information on a per sample basis, and reflects realtime updates to the OUT\_P and OUT\_T registers. The same STATUS register can be read through an alternate address 00h (F\_Mode = 00).

Table 14. DR\_STATUS - status register (address 06h) bit allocation

Bit	7	6	5	4	3	2	1	0
Symbol	PTOW	POW	TOW	reserved	PTDR	PDR	TDR	reserved
Reset	0	0	0	0	0	0	0	0
Access	R	R	R	R	R	R	R	R

#### Table 15. DR\_STATUS - status register (address 06h) bit description

Bit	Symbol	Description
7	PTOW <sup>[1]</sup>	Pressure/altitude or temperature data overwrite. PTOW is set to 1 whenever new data is acquired before completing the retrieval of the previous set. This event occurs when the content of at least one data register (OUT_P, OUT_T) has been overwritten. PTOW is cleared when the high-bytes of the data (OUT_P_MSB or OUT_T_MSB) are read, when F_MODE is zero. PTOW is cleared by reading F_DATA register when F_MODE > 0.
		0 — No data overwrite has occurred (reset value)
		1 — Previous pressure/altitude or temperature data was overwritten by new pressure/altitude or temperature data before it was read
6	POW <sup>[2]</sup>	Pressure/altitude data overwrite. POW is set to 1 whenever a new pressure/altitude acquisition is completed before the retrieval of the previous data. When this occurs, the previous data is overwritten. POW is cleared anytime OUT_P_MSB register is read, when F_MODE is zero. POW is cleared by reading F_DATA register when F_MODE > 0.
		0 — No data overwrite has occurred (reset value)
		1 — Previous pressure/altitude data was overwritten by new pressure/altitude data before it was read
5	TOW <sup>[3]</sup>	Temperature data overwrite. TOW is set to 1 whenever a new temperature acquisition is completed before the retrieval of the previous data. When this occurs, the previous data is overwritten. TOW is cleared anytime OUT_T_MSB register is read, when F_MODE is zero. TOW is cleared by reading F_DATA register when F_MODE > 0. <b>0</b> — No data overwrite has occurred (reset value)
		1 — Previous temperature data was overwritten by new temperature data before it was read
4	reserved	This bit is reserved
3	PTDR <sup>[1]</sup>	Pressure/altitude or temperature data ready. PTDR signals that a new acquisition for either pressure/altitude or temperature is available. PTDR is cleared anytime OUT_P_MSB or OUT_T_MSB register is read, when F_MODE is zero. PTDR is cleared by reading F_DATA register when F_MODE > 0.
		0 — No new set of data ready (reset value)

© 2024 NXP B.V. All rights reserved.

### I<sup>2</sup>C precision pressure sensor with altimetry

Bit	Symbol	Description
		1 — A new set of data is ready
2	PDR <sup>[2]</sup>	New pressure/altitude data available. PDR is set to 1 whenever a new pressure/altitude data acquisition is completed. PDR is cleared anytime OUT_P_MSB register is read, when F_MODE is zero. PDR is cleared by reading F_DATA register when F_MODE > 0. <b>0</b> — No new pressure/altitude data is available (reset value) <b>1</b> — A new set of pressure/altitude data is ready
1	TDR <sup>[3]</sup>	New temperature data available. TDR is set to 1 whenever a temperature data acquisition is completed. TDR is cleared anytime OUT_T_MSB register is read, when F_MODE is zero. TDR is cleared by reading F_DATA register when F_MODE > 0. <b>0</b> — No new temperature data ready (reset value) <b>1</b> — A new temperature data is ready
0	reserved	This bit is reserved

#### Table 15. DR\_STATUS - status register (address 06h) bit description...continued

PTDR and PTOW flag generation requires the DREM event flag generator to be enabled in the PT data configuration register (PT\_DATA\_CFG).
 PDR and POW flag generation is required for the pressure/altitude event flag generator to be enabled (PDEFE = 1) in the PT data configuration register

(PT\_DATA\_CFG).
 [3] TDR and TOW flag generation is required for the temperature event flag generator to be enabled (TDEFE = 1) in the PT data configuration register (PT

[3] TDR and TOW flag generation is required for the temperature event flag generator to be enabled (TDEFE = 1) in the PT data configuration register (PT\_DATA\_CFG).

## 14.2.1 Data registers with F\_MODE = 00 (FIFO disabled)

When the FIFO data output register, F\_DATA (0Eh), is disabled (F\_MODE[7:6] = 00 in the F\_SETUP register, 0Fh), the pressure and altitude data registers indicate the real-time status information of the sample data. This data can be either altimeter or barometer data based on the mode defined by the ALT bit in the CTRL\_REG1 register. See <u>Section 14.8 "FIFO setup registers"</u> for additional information.

# 14.3 OUT\_P\_MSB, OUT\_P\_CSB, OUT\_P\_LSB - pressure and altitude data registers (address 01h, 02h, 03h)

Pressure and altitude data registers 01h, 02h, and 03h comprise the pressure and altitude data depending on the setting of the ALT bit in the CTRL\_REG1 register, in either altimeter or barometer mode. For example if the ALT bit is set (ALT = 1) then after acquisition the data stored in registers 01h, 02h, and 03h is the altitude in meters. Otherwise the data stored in registers 01h, 02h, and 03h (ALT = 0) is pressure data in Pascals.

The altitude data is stored as a 20-bit signed integer with a fractional part. The OUT\_P\_MSB (01h) and OUT\_P\_CSB (02h) registers contain the integer part in meters and the OUT\_P\_LSB (03h) register contains the fractional part. This value is represented as a Q16.4 fixed-point format where there are 16 integer bits (including the signed bit) and four fractional bits.

The pressure data is stored as a 20-bit unsigned integer with a fractional part. The OUT\_P\_MSB (01h), OUT\_P\_CSB (02h), and bits 7 to 6 of the OUT\_P\_LSB (03h) registers contain the integer part in Pascals. Bits 5 to 4 of OUT\_P\_LSB contain the fractional component. This value is representative as a Q18.2 fixed-point format where there are 18 integer bits and two fractional bits.

### I<sup>2</sup>C precision pressure sensor with altimetry

Lo	cation	Bit									
Address	Register	7	6	5	4	3	2	1	0		
01h	OUT_P_MSB				PD[1	[9:12]					
02h	OUT_P_CSB		PD[11:4]								
03h	OUT_P_LSB		PD[3:0]				reserved				
Reset		0	0	0	0	0 0 0 0			0		
Access		R	R	R	R	R R R R			R		

Table 16. OUT\_P\_MSB, OUT\_P\_CSB, OUT\_P\_LSB - pressure and altitude data registers (address 01h, 02h, 03h) bit allocation

### 14.3.1 Data registers with F\_MODE = 00

The DR\_STATUS, OUT\_P\_MSB, OUT\_P\_CSB, OUT\_P\_LSB, OUT\_T\_MSB, and OUT\_T\_LSB registers are stored in the auto-incrementing address range of 00h to 05h. This allows the host controller to read the status register followed by the 20-bit pressure/altitude and 12-bit temperature in a 6 byte I<sup>2</sup>C transaction.

See Section 14.8 "FIFO setup registers" for additional information.

## 14.4 OUT\_T\_MSB, OUT\_T\_LSB - temperature data registers (address 04h, 05h)

The temperature data is stored as a signed 12-bit integer with a fractional part. The OUT\_T\_MSB (04h) register contains the integer part in °C and the OUT\_T\_LSB (05h) register contains the fractional part. This value is representative as a Q8.4 fixed-point format where there are eight integer bits (including the signed bit) and four fractional bits.

Lo	cation	Bit									
Address	ess Register 7 6 5 4 3 2					1	0				
04h	OUT_T_MSB		TD[11:4]								
05h	OUT_T_LSB		TD[	3:0]			rese	rved			
Reset		0	0	0	0	0 0 0 0			0		
Access		R R R R R R R				R					

Table 17. OUT\_T\_MSB, OUT\_T\_LSB - temperature data registers (address 04h, 05h) bit allocation

# 14.5 OUT\_P\_DELTA\_MSB, OUT\_P\_DELTA\_CSB, OUT\_P\_DELTA\_LSB - pressure and altitude delta register (address 07h, 08h, 09h)

The pressure and altitude delta registers 07h, 08h, and 09h comprise the pressure and altitude delta data and provide the differences from either the last pressure or altitude samples based on the setting of the ALT bit in the CTRL\_REG1 register. Device can be in either altimeter or barometer mode.

The altitude data is arranged as a 20-bit signed integer with a fractional part. Stored as meters with the 16 bits of OUT\_P\_DELTA\_MSB and OUT\_P\_DELTA\_CSB and with fractions of a meter stored in 4 bits in position 7 to 4 of OUT\_P\_DELTA\_LSB.

The pressure is arranged as a 20-bit unsigned integer with a fractional part in Pascals. The first 18 bits are located in OUT\_P\_DELTA\_MSB, OUT\_P\_DELTA\_CSB, and bits 7 to 6 of OUT\_P\_DELTA\_LSB. The two bits in position 5 to 4 of OUT\_P\_DELTA\_LSB represent the fractional component.

**Note:** The OUT\_P\_DELTA register store the difference data information regardless of the state of the FIFO data output register driver bit,  $F_MODE > 00$ .

FXPQ3115BVS

### I<sup>2</sup>C precision pressure sensor with altimetry

(address 07h, 08h, 09h) bit allocation	Table 18.	OUT_P_DELTA	MSB, OUT_P_D	ELTA_CSB, OUT_	P_DELTA_	LSB - pressure and altitude delta register
	(address	07h, 08h, 09h) b	it allocation			

	Location	Bit									
Address Register		7	6	5	4	3	2	1	0		
07h	OUT_P_DELTA_MSB	PDD[19:12]									
08h OUT_P_DELTA_CSB		PDD[11:4]									
09h	OUT_P_DELTA_LSB	PDD[3:0] reserved									
Reset		0	0	0	0	0	0	0	0		
Access		R	R	R	R	R	R	R	R		

# 14.6 OUT\_T\_DELTA\_MSB, OUT\_T\_DELTA\_LSB - temperature delta register (address 0Ah, 0Bh)

The temperature delta register 0Ah and 0Bh comprise the temperature delta data and provide the difference from the last temperature samples.

The temperature data is arranged as 12-bit signed integer with a fractional part in °C. The eight bits of OUT\_T\_DELTA\_MSB representing degrees and with fractions of a degree stored in four bits in position 7 to 4 of OUT\_T\_DELTA\_LSB.

**Note:** The OUT\_T\_DELTA register store the difference data information regardless of the state of the FIFO data output register driver bit,  $F_MODE > 00$ .

Table 19. OUT\_T\_DELTA\_MSB, OUT\_T\_DELTA\_LSB - temperature delta register (address 0Ah, 0Bh) bit allocation

	Location	Bit									
Address	Register	7	6	5	4	3	2	1	0		
0Ah	OUT_T_DELTA_MSB	TDD[11:4]									
0Bh	OUT_T_DELTA_LSB		TDD[3:0]			reserved					
Reset		0	0	0	0	0	0	0	0		
Access		R	R	R	R	R	R	R	R		

### 14.7 WHO\_AM\_I - device ID register (address 0Ch)

This register contains the device identifier which is set to C5h by default. The value is factory programmed. Consult the NXP factory for custom alternate values.

Table 20.	WHO	АМ	I - device	ID register	(address	0Ch	bit allocation
				ib rogiotor	laaarooo	0011	, bit anooution

Bit	7	6	5	4	3	2	1	0
Symbol				WHO_A	M_I[7:0]			
Reset	0	0 0 0 0 0 0 0 0						
Access	NVM data 1	NVM data 1	NVM data 0	NVM data 0	NVM data 0	NVM data 1	NVM data 0	NVM data

FXPQ3115BVS Product data sheet

I<sup>2</sup>C precision pressure sensor with altimetry

### 14.8 FIFO setup registers

#### 14.8.1 F\_STATUS - FIFO status register (address 0Dh)

Table 21. F\_STATUS - FIFO status register (address 0Dh) bit allocation

Bit	7	6	5	4	3	2	1	0
Symbol	F_OVF	F_WMRK_FLAG			F_CN	T[5:0]		
Reset	0	0	0	0	0	0	0	0
Access	R	R	R	R	R	R	R	R

 Table 22. F\_STATUS - FIFO status register (address 0Dh) bit description

F_OVF	F_WMRK_FLAG	Event description
0	—	No FIFO overflow events detected.
1	—	FIFO overflow event detected.
	0	No FIFO watermark events detected.
_	1	FIFO watermark event detected. FIFO sample count greater than watermark value

The F\_OVF and F\_WMRK\_FLAG flags remain asserted while the event source is still active, but the user can clear the FIFO interrupt bit flag in the interrupt source register (INT\_SOURCE) by reading the F\_STATUS register. Therefore, the F\_OVF bit flag will remain asserted while the FIFO has overflowed and the F\_WMRK\_FLAG bit flag will remain asserted while the F\_CNT value is greater than then F\_WMRK value.

Table 23. F\_STATUS - FIFO status register (address 0Dh) bit description

Bit	Symbol	Description
5 to 0	F_CNT	FIFO sample counter. F_CNT[5:0] bits indicate the number of samples currently stored in the FIFO buffer.
		00_0000 — indicates that the FIFO is empty (reset value)
		00_0001 to 10_0000 — indicates 1 to 32 samples stored in FIFO

### 14.8.2 F\_DATA - FIFO data register (address 0Eh)

F\_DATA is a read only address which provides access to 8-bit FIFO data. FIFO holds a maximum of 32 samples, a maximum of  $5 \times 32 = 160$  data bytes of samples can be read. When F\_MODE bit in FIFO SETUP (F\_SETUP) register is set to logic '1', the F\_DATA pointer shares the same address location as OUT\_P\_MSB (01h), therefore all accesses of the FIFO buffer data use the I<sup>2</sup>C address 01h. Reads from the other data registers (02h, 03h, 04h, 05h) will return a value of 00h.

**Note:** The FIFO will NOT suspend to data accumulation during read transactions to F\_DATA.

		uutu rogiotoi	(4444.000 011	, sit ano oatio				
Bit	7	7 6 5 4 3 2 1 0						
Symbol		F_DATA[7:0]						
Reset	0	0 0 0 0 0 0 0 0						
Access	R	R	R	R	R	R	R	R

Table 24. F\_DATA - FIFO data register (address 0Eh) bit allocation

FXPQ3115BVS Product data sheet

### I<sup>2</sup>C precision pressure sensor with altimetry

Table 25. Read accesses through F_DATA	
1st read (1 byte)	OUT_P_MSB (oldest)
2nd read (1 byte)	OUT_P_CSB (oldest)
3rd read (1 byte)	OUT_P_LSB (oldest)
4th read (1 byte)	OUT_T_MSB (oldest)
5th read (1 byte)	OUT_T_LSB (oldest)
· ·	
158th read (1 byte)	OUT_T_LSB (oldest)
159th read (1 byte)	00h
160th read (1 byte)	00h

#### Table 25. Read accesses through F\_DATA

### 14.8.3 F\_SETUP- FIFO setup register (address 0Fh)

A FIFO sample count exceeding the watermark event does not stop the FIFO from accepting new data.

The FIFO update rate is dictated by the selected system acquisition rate (ST bits of CTRL\_REG2).

When a byte is read from the FIFO buffer the oldest sample data in the FIFO buffer is returned and also deleted from the front of the FIFO buffer, while the FIFO sample count is decremented by one. It is assumed that the host application shall use the  $I^2C$  BURST read transaction to dump the FIFO.

Bit	7	6	5 4 3 2 1 0						
Symbol	F_MO	F_MODE[1:0]		F_WMRK[5:0]					
Reset	0	0	0	0	0	0	0	0	
Access	R	R	R	R	R	R	R	R	

Table 26. F\_SETUP- FIFO setup register (address 0Fh) bit allocation

# I<sup>2</sup>C precision pressure sensor with altimetry

Bit	Symbol	Description
7 to 6	F_MODE[7:6] <sup>[1][2]</sup>	FIFO buffer overflow mode.
		<b>00</b> — FIFO is disabled (reset value)
		01 — FIFO contains the most recent samples when overflowed (circular buffer).
		Oldest sample is discarded to be replaced by new sample
		10 — FIFO stops accepting new samples when overflowed
		11 — Not used
		The FIFO is flushed whenever the FIFO is disabled, or transitioning from STANDBY mode to ACTIVE mode. Disabling the FIFO ( $F_MODE = 00$ ) resets the $F_OVF$ , $F_WMRK_FLAG$ , $F_CNT$ to zero. A FIFO overflow event (as when $F_CNT = 32$ ) will assert the $F_OVF$ flag and a FIFO sample count equal to the sample count watermark ( $F_WMRK$ ) asserts the $F_WMRK_FLAG$ event flag. To switch between FIFO modes, first disable the FIFO and then write the new value to $F_MODE$ .
5 to 0	F_WMRK[5:0] <sup>[3]</sup>	FIFO event sample count watermark. These bits set the number of FIFO samples required to trigger a watermark interrupt. A FIFO watermark event flag (F_WMRK_FLAG) is raised when FIFO sample count F_CNT[5:0] value is equal to the F_ WMRK[5:0] watermark. <b>00_0000</b> — FIFO is disabled (reset value) Setting the F_WMRK[5:0] to 00_0000 will disable the FIFO watermark event flag generation.

Table 27. F SETUP- FIFO setup register (address 0Fh) bit description

This bit field can be written in ACTIVE mode. [1]

This bit field can be written in STANDBY mode. The FIFO mode (F\_MODE) cannot be switched between the two operational modes (01 and 10). [2] [3]

# 14.9 TIME DLY - time delay register (address 10h)

The time delay register contains the number of ticks of data sample time since the last byte of the FIFO was written. This register starts to increment on FIFO overflow or data wrap and clears when the last byte of FIFO is read.

Bit	7	6	5	4	3	2	1	0
Symbol		TD[7:0]						
Reset	0	0 0 0 0 0 0 0 0						
Access	R	R	R	R	R	R	R	R

Table 28 TIME DLY - time delay register (address 10b) bit allocation

### 14.10 SYSMOD - system mode register (address 11h)

Table 29. SYSMOD - system mode register (address 11h) bit allocation

Bit	7	6	5	4	3	2	1	0
Symbol				reserved				SYSMOD
Reset	0	0	0	0	0	0	0	0
Access	R	R	R	R	R	R	R	R

# I<sup>2</sup>C precision pressure sensor with altimetry

Bit	Symbol	Description				
7 to 1	reserved	These bits are reserved and will always read 0				
0		System mode <b>0</b> — STANDBY mode (reset value) <b>1</b> — ACTIVE mode				

#### Table 30. SYSMOD - system mode register (address 11h) bit description

# 14.11 INT\_SOURCE - system interrupt status register (address 12h)

The interrupt source register bits that are set (logic '1') to indicate which function has asserted its interrupt and conversely, bits that are cleared (logic '0') indicate which function has not asserted its interrupt.

The setting of the bits is rising edge sensitive, the bit is set by a low to high state change and reset by reading the appropriate source register.

Table 31. INT SO	URCE - system interru	pt status register (	address 12h	) bit allocation

Bit	7	6	5	4	3	2	1	0
Symbol	SRC_DRDY	SRC_FIFO	SRC_PW	SRC_TW	SRC_PTH	SRC_TTH	SRC_PCHG	SRC_TCHG
Reset	0	0	0	0	0	0	0	0
Access	R	R	R	R	R	R	R	R

Table 32. INT	SOURCE - system	interrupt status	register (address	12h) bit description
---------------	-----------------	------------------	-------------------	----------------------

Bit	Symbol	Description
7	SRC_DRDY	Data ready interrupt status bit. Logic '1' indicates that pressure/altitude or temperature data ready interrupt is active indicating the presence of new data and/or a data overwrite, otherwise it is a logic '0'.
		This bit is asserted when the PTOW and/or PTDR is set and the functional block interrupt has been enabled. This bit is cleared by reading the STATUS and pressure/temperature register.
6	SRC_FIFO	FIFO interrupt status bit. Logic '1' indicates that a FIFO interrupt event such as an overflow event has occurred.
		FIFO interrupt event generators: FIFO overflow, or (watermark: F_CNT = F_WMRK).
		<b>0</b> — no FIFO interrupt event has occurred. (reset value) This bit is cleared by reading the F_ STATUS register.
		<b>1</b> — A FIFO interrupt event such as an overflow event has occurred.

# I<sup>2</sup>C precision pressure sensor with altimetry

Bit	Symbol	Description
5	SRC_PW	<ul> <li>Pressure/altitude alerter status bit near or equal to target pressure/altitude (near is within target value ± window value).</li> <li>0 — (reset value)</li> <li>The window value must be non-zero for interrupt to trigger.</li> </ul>
4	SRC_TW	<ul> <li>Temperature alerter status bit near or equal to target temperature (near is within target value ± window value.)</li> <li>0 — (reset value)</li> <li>The window value must be non-zero for interrupt to trigger.</li> </ul>
3	SRC_PTH	<ul> <li>Pressure/altitude threshold interrupt.</li> <li>0 — If the window is set to 0, it will only trigger on crossing the center threshold. (reset value)</li> <li>1 — With the window set to a non-zero value, the trigger will occur on crossing any of the thresholds: upper, center, or lower.</li> </ul>
2	SRC_TTH	<ul> <li>Temperature threshold interrupt.</li> <li>0 — If the window is set to 0, it will only trigger on crossing the center threshold.(reset value)</li> <li>1 — With the window set to a non-zero value, the trigger will occur on crossing any of the thresholds: upper, center, or lower.</li> </ul>
1	SRC_PCHG	Delta P interrupt status bit. <b>0 —</b> (reset value)
0	SRC_TCHG	Delta T interrupt status bit. <b>0 —</b> (reset value)

#### Table 32. INT\_SOURCE - system interrupt status register (address 12h) bit description...continued

# 14.12 PT\_DATA\_CFG - sensor data register (address13h)

The PT\_DATA\_CFG register configures the pressure data, temperature data, and event flag generator.

Bit	7	6	5	4	3	2	1	0
Symbol			reserved	DREM	PDEFE	TDEFE		
Reset	0	0 0 0 0 0					0	0
Access	R	R	R	R	R	R/W	R/W	R/W

Table 33. PT\_DATA\_CFG - sensor data register (address13h) bit allocation

### I<sup>2</sup>C precision pressure sensor with altimetry

Bit	Symbol	Description
7 to 3	reserved	These bits are reserved
2	DREM	<ul> <li>Data ready event mode.</li> <li>0 — Event detection disabled (reset value) If the DREM bit is cleared logic '0' and one or more of the data ready event flags are enabled, then an event flag will be raised whenever the system acquires a new set of data.</li> <li>1 — Generate data ready event flag on new pressure/altitude or temperature data. If the DREM bit is set logic '1' and one or more of the data ready event flags (PDEFE, TDEFE) are enabled, then an event flag will be raised upon change in state of the data.</li> </ul>
1	PDEFE	Data event flag enable on new pressure/altitude <b>0</b> — Event detection disabled (reset value) <b>1</b> — Raise event flag on new pressure/altitude data
0	TDEFE	<ul> <li>Data event flag enable on new temperature data.</li> <li>0 — Event detection disabled (reset value)</li> <li>1 — Raise event flag on new temperature data</li> </ul>

#### Table 34. PT\_DATA\_CFG - sensor data register (address13h) bit description

# 14.13 BAR\_IN\_MSB, BAR\_IN\_LSB - barometric pressure input register (address 14h, 15h)

Barometric input for altitude calculations. Input is equivalent to sea level pressure for measurement location. Value is input in 2 Pa units.

Units are input as unsigned 16-bit integers. The default value is 101,326 Pa. The default value can be changed by writing to this register.

Location			Bit								
Address	Register	7	7 6 5 4 3 2 1 0								
14h	BAR_IN_MSB		BAR[15:8]								
15h	BAR_IN_LSB				BAR	[7:0]					
Reset MSE Reset LSB		1 1	1 1	0 1	0 0	0 0	1 1	0 1	1 1		
Access		R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W		

Table 35. BAR\_IN\_MSB, BAR\_IN\_LSB - barometric pressure input register (address 14h, 15h) bit allocation

# 14.14 P\_TGT\_MSB, P\_TGT\_LSB - pressure/altitude target value register (address 16h, 17h)

Altitude or pressure target value.

Depending on the setting of the ALT bit in the CTRL\_REG1 register, it operates in either altimeter or barometer mode. This value works in conjunction with the window value (P\_WND\_MSB and P\_WND\_LSB). In altitude mode, the register value is 16-bit signed integer in meters.

In pressure mode, the value is a 16-bit unsigned value in 2 Pa units.

## I<sup>2</sup>C precision pressure sensor with altimetry

Lo	cation		Bit							
Address	Register	7							0	
16h	P_TGT_MSB		P_TGT[15:8]							
17h	P_TGT_LSB				P_TG	T[7:0]				
Reset		0	0 0 0 0 0 0 0 0						0	
Access         R/W         R/W<					R/W					

# Table 36. P\_TGT\_MSB, P\_TGT\_LSB - pressure/altitude target value register (address 16h, 17h) bit allocation

# 14.15 T\_TGT- temperature target value register (address 18h)

Temperature target value is input as an 8-bit signed integer in °C.

Bit	7	6	5	4	3	2	1	0					
Symbol		T_TGT[7:0]											
Reset	0	0	0	0	0	0	0	0					
Access	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W					

# 14.16 P\_WND\_LSB, P\_WND\_MSB - pressure/altitude window value register (address 19h, 1Ah)

Pressure or altitude window value register is arranged as an unsigned 16-bit integer of window value in meters or in 2 Pa units, depending on either altimeter or barometer mode.

 Table 38.
 P\_WND\_LSB, P\_WND\_MSB - pressure/altitude window value register (address 19h, 1Ah) bit allocation

Lo	ocation		Bit							
Address	Register	7	7         6         5         4         3         2         1         0							
19h	P_WND_LSB				P_W	[15:8]		1		
1Ah	P_WND_MSB				P_W	/[7:0]				
Reset	teset 0 0 0 0 0 0 0 0					0				
Access R/W R/W R/W R/W R				R/W	R/W	R/W	R/W			

# 14.17 T\_WIN- temperature window value register (address 1Bh)

The temperature alarm window value register is an unsigned 8-bit value in °C.

Bit	7	6	5	4	3	2	1	0	
Symbol	T_WIN[7:0]								
Reset	0	0	0	0	0	0	0	0	
Access	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W	

Table 39. T\_WIN- temperature window value register (address 1Bh) bit allocation

FXPQ3115BVS Product data sheet

I<sup>2</sup>C precision pressure sensor with altimetry

# 14.18 P\_MIN\_MSB, P\_MIN\_CSB, P\_MIN\_LSB - minimum pressure or altitude register (address 1Ch, 1Dh, 1Eh)

Register with captured minimum pressure or altitude value.

The altitude data is arranged as a 20-bit signed integer in meters. The first 16 bits are located in P\_MIN\_MSB and P\_MIN\_CSB. Fractions of a meter are stored in 4 bits in position 7 to 4 of P\_MIN\_LSB.

The pressure is arranged as a 20-bit unsigned data in Pascals. The first 18 bits are located in P\_MIN\_MSB, P\_MIN\_CSB, and bits 7 to 6 of P\_MIN\_LSB. The two bits in position 5 to 4 of P\_MIN\_LSB represent the fractional component.

The register is cleared on power-up or manually by writing '0' to the register.

Table 40. P\_MIN\_MSB, P\_MIN\_CSB, P\_MIN\_LSB - minimum pressure or altitude register (address 1Ch, 1Dh, 1Eh) bit allocation

Location		Bit								
Address	Register	7	7 6 5 4 3 2					1	0	
1Ch	P_MIN_MSB		P_MIN[19:12]							
1Dh	P_MIN_CSB		P_MIN[11:4]							
1Eh	P_MIN_LSB		P_MIN[3:0]				reserved			
Reset		0	0	0	0	0	0	0	0	
Access MS	SB	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W	
Access CS	Access CSB		R/W	R/W	R/W	R/W	R/W	R/W	R/W	
Access LSB		R/W	R/W	R/W	R/W	R	R	R	R	

# 14.19 P\_MAX\_MSB, P\_MAX\_CSB, P\_MAX\_LSB - maximum pressure or altitude register (address 21h, 22h, 23h)

Register with captured maximum pressure or altitude value.

The altitude data is arranged as a 20-bit signed integer in meters. The first 16 bits are located in P\_MAX\_MSB and P\_MAX\_CSB. Fractions of a meter stored in 4 bits in position 7 to 4 of P\_MAX\_LSB.

The pressure is arranged as a 20-bit unsigned data in Pascals. The first 18 bits are located in P\_MAX\_MSB, P\_MAX\_CSB, and bits 7 to 6 of P\_MAX\_LSB. The two 2 bits in position 5 to 4 of P\_MAX\_LSB represent the fractional component.

The register is cleared on power-up or manually by writing '0' to the registers.

 Table 41. P\_MAX\_MSB, P\_MAX\_CSB, P\_MAX\_LSB - maximum pressure or altitude register (address 21h, 22h, 23h)

 bit allocation

Location		Bit									
Address	Register	7	7 6 5 4 3 2 1 0								
21h	P_MAX_MSB		P_MAX[19:12]								
22h	P_MAX_CSB		P_MAX[11:4]								
23h	P_MAX_LSB		P_MAX[3:0] reserved					rved			
Reset		0	0	0	0	0	0	0	0		
Access M	SB	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W		
Access C	SB	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W		
Access LS	SB	R/W	R/W	R/W	R/W	R	R	R	R		
FXPQ3115BVS			All information p	rovided in this docume	ent is subject to legal c	lisclaimers.	1	© 2024 NXP B	.V. All rights reserve		

Product data sheet

### I<sup>2</sup>C precision pressure sensor with altimetry

# 14.20 T\_MIN\_MSB, T\_MIN\_LSB - minimum temperature register (address 1Fh, 20h)

Register with captured minimum temperature value.

The temperature data is arranged as a 12-bit signed integer in °C. The first eight bits are located in T\_MIN\_MSB with fractions of a degree stored in four bits in position 7 to 4 of T\_MIN\_LSB.

The register is cleared on power-up or manually by writing '0' to the registers.

Table 42. T\_MIN\_MSB, T\_MIN\_LSB - minimum temperature register (address 1Fh, 20h) bit allocation

Location		Bit								
Address	Register	7	7 6 5 4				2	1	0	
1Fh	T_MIN_MSB		T_MIN[11:4]							
20h	T_MIN_LSB		T_MIN[3:0]				reserved			
Reset		0	0	0	0	0	0	0	0	
Access MSB Access LSB		R/W R/W	R/W R/W	R/W R/W	R/W R/W	R/W         R/W         R/W           R         R         R		R/W R		

## 14.21 T\_MAX\_MSB, T\_MAX\_LSB - maximum temperature register (address 24h, 25h)

Register with captured maximum temperature value.

The temperature data is arranged as a 12-bit signed integer in °C. The first eight bits are located in T\_MAX\_MSB with fractions of a degree stored in four bits in position 7 to 4 of T\_MAX\_LSB.

The register is cleared on power-up or manually by writing '0' to the registers.

Location		Bit								
Address	Register	7	7 6 5 4 3					1	0	
24h	T_MAX_MSB		T_MAX[11:4]							
25h	T_MAX_LSB		T_MAX[3:0]				reserved			
Reset		0	0	0	0	0	0	0	0	
Access MSB Access LSB		R/W R/W	R/W R/W	R/W R/W	R/W R/W	R/W R	R/W R	R/W R	R/W R	

### 14.22 Control registers

#### 14.22.1 CTRL\_REG1 - control register 1 (address 26h)

**Note:** Except for STANDBY and OST mode selection, the device must be in STANDBY mode to change any of the fields within bits 7 to 0 of CTRL\_REG1 (26h).

Bit	7	6	5	4	3	2	1	0
Symbol	ALT	Reserved	OS[2:0]			0 (R) RST (W)	OST	SBYB
Reset	0	0	0	0	0	0	0	0
Access	R/W	R	R/W	R/W	R/W	R/W	R/W	R/W

Table 44. CTRL\_REG1 - control register 1 (address 26h) bit allocation

FXPQ3115BVS Product data sheet © 2024 NXP B.V. All rights reserved.

# I<sup>2</sup>C precision pressure sensor with altimetry

Bit	Symbol	Description						
7	ALT	Altimeter/barometer mode. <b>0</b> — Part is in barometer mode (reset value) <b>1</b> — Part is in altimeter mode						
6	Reserved							
5 to 3	OS[2:0]	Oversample ratio. These bits select the oversampling ratio. Value is 2 <sup>OS</sup> . The default value is 000 for a ratio of 1.						
2	0 (R) RST (W)	Software reset. This bit is used to activate the software reset. The boot mechanism can be enabled in STANDBY and ACTIVE mode.						
		When the boot bit is enabled, the boot mechanism resets all functional block registers an loads the respective internal registers with default values.						
		If the system was already in STANDBY mode, the reboot process will immediately begin, or else if the system was in ACTIVE mode, the boot mechanism will automatically transition the system from ACTIVE mode to STANDBY mode. Only then can the reboot process begin.						
		The I <sup>2</sup> C communication system is reset to avoid accidental corrupted data access. At the end of the boot process, the RST bit is de-asserted to 0. Reading this bit will return a value of zero.						
		<ul> <li>0 — Device reset disabled (reset value)</li> <li>1 — Device reset enabled</li> </ul>						
1	OST	OST bit will initiate a measurement immediately. If the SBYB bit is set to active, setting the OST bit will initiate an immediate measurement, the part will then return to acquiring data as per the setting of the ST bits in CTRL_REG2. In this mode, the OST bit does not clear itself and must be cleared and set again to initiate another immediate measurement.						
		In one-shot mode, when SBYB is 0, the OST bit is an autoclear bit. When OST is set, the device initiates a measurement by going into active mode. Once a pressure/altitude and temperature measurement is completed, it clears the OST bit and comes back to STANDBY mode. User shall read the value of the OST bit before writing to this bit again.						
0	SBYB	This bit sets the mode to ACTIVE, where the system will make measurements at periodic times based on the value of ST bits.						
		<ul> <li>0 — Part is in STANDBY mode (reset value)</li> <li>1 — Part is ACTIVE</li> </ul>						

#### Table 45. CTRL\_REG1 - control register 1 (address 26h) bit description

#### Table 46. System output sample rate selection

OS2	OS1	OS0	Oversample ratio	Minimum time between data samples
0	0	0	1	6 ms
0	0	1	2	10 ms
0	1	0	4	18 ms
0	1	1	8	34 ms
1	0	0	16	66 ms
1	0	1	32	130 ms
1	1	0	64	258 ms
1	1	1	128	512 ms

# I<sup>2</sup>C precision pressure sensor with altimetry

## 14.22.2 CTRL\_REG2 - control register 2 (address 27h)

#### Table 47. CTRL\_REG2 - control register 2 (address 27h) bit allocation

Bit	7	6	5	4	3	2	1	0
Symbol	reserved		LOAD_OUTPUT	ALARM_SEL	ST[3:0]			
Reset	0	0	0	0	0	0	0	0
Access	R	R	R/W	R/W	R/W	R/W	R/W	R/W

Table 48. CTRL\_REG2 - control register 2 (address 27h) bit description

Bit	Symbol	Description
7 to 6	reserved	These bits are reserved.
5	LOAD_OUTPUT	<ul> <li>This is to load the target values for SRC_PW/SRC_TW and SRC_PTH/SRC_TTH.</li> <li>0 — Do not load OUT_P/OUT_T as target values (reset value)</li> <li>1 — The next values of OUT_P/OUT_T are used to set the target values for the interrupts.</li> <li>Notes:</li> <li>This bit must be set at least once if ALARM_SEL=1</li> <li>To reload the next OUT_P/OUT_T as the target values, clear and set again.</li> </ul>
4	ALARM_SEL	The bit selects the target value for SRC_PW/SRC_TW and SRC_PTH/SRC_TTH. <b>0</b> — (reset value) The values in P_TGT_MSB, P_TGT_LSB and T_TGT are used. <b>1</b> — The values in OUT_P/OUT_T are used for calculating the interrupts SRC_PW/SRC_TW and SRC_PTH/SRC_TTH.
3 to 0	ST[3:0]	Auto acquisition time step. <b>0</b> — (reset value) <b>Step value is 2<sup>ST</sup></b> — Giving a range of 1 second to 215 seconds (9 hours)

# 14.22.3 CTRL\_REG3 - interrupt CTRL register (address 28h)

Table 49. C	TRL REG3 -	interrupt CTRL	register	(address	28h) bit allocation

Bit	7	6	5	4	3	2	1	0
Symbol	rese	rved	IPOL1	PP_OD1	rese	rved	IPOL2	PP_OD2
Reset	0	0	0	0	0	0	0	0
Access	R	R	R/W	R/W	R	R	R/W	R/W

# I<sup>2</sup>C precision pressure sensor with altimetry

Bit	Symbol	Description
7 to 6	reserved	These bits are reserved.
5	IPOL1	The IPOL bit selects the polarity of the interrupt signal. When IPOL is '0' (default value), any interrupt event is signaled with a logical '0'. Interrupt Polarity active high, or active low on interrupt pad INT1. <b>0</b> — Active low (reset value) <b>1</b> — Active high
4	PP_OD1	This bit configures the interrupt pin to push-pull or in open-drain mode. The default value is 0 which corresponds to push-pull mode. The open-drain configuration can be used for connecting multiple interrupt signals on the same interrupt line. push-pull/open-drain selection on interrupt pad INT1. <b>0</b> — Internal pullup (reset value) <b>1</b> — Open-drain
3 to 2	reserved	These bits are reserved.
1	PP_OD2	Interrupt polarity active high, or active low on interrupt pad INT2. <b>0</b> — Active low (reset value) <b>1</b> — Active high
0	PP_OD2	Push-pull/open-drain selection on interrupt pad INT2. <b>0</b> — Internal pullup (reset value) <b>1</b> — Open-drain

#### Table 50. CTRL\_REG3 - interrupt CTRL register (address 28h) bit description

### 14.22.4 CTRL\_REG4 - interrupt enable register (address 29h)

The corresponding functional block interrupt enable bit allows the functional block to route its event detection flags to the system's interrupt controller. The interrupt controller routes the enabled functional block interrupt to the INT1 or INT2 pin.

Table 51. CTRL_REG4 - interrupt enable register (address 29h) bit allocation
------------------------------------------------------------------------------

Bit	7	6	5	4	3	2	1	0
Symbol	INT_EN_DRDY	INT_EN_FIFO	INT_EN_PW	INT_EN_TW	INT_EN_PTH	INT_EN_TTH	INT_EN_PCHG	INT_EN_TCHG
Reset	0	0	0	0	0	0	0	0
Access	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W

#### Table 52. CTRL\_REG4 - interrupt enable register (address 29h) bit description

Bit	Symbol	Description
7	INT_EN_DRDY	Interrupt enable. <b>0</b> — Data ready interrupt disabled (reset value) <b>1</b> — Data ready interrupt enabled
6	INT_EN_FIFO	Interrupt enable. <b>0</b> — FIFO interrupt disabled (reset value) <b>1</b> — FIFO interrupt enabled
5	INT_EN_PW	Interrupt enable. <b>0</b> — Pressure window interrupt disabled (reset value) <b>1</b> — Pressure window interrupt enabled

# I<sup>2</sup>C precision pressure sensor with altimetry

Bit	Symbol	Description
4	INT_EN_TW	Interrupt enable. <b>0</b> — Temperature window interrupt disabled (reset value) <b>1</b> — Temperature window interrupt enabled
3	INT_EN_PTH	Interrupt enable. <b>0</b> — Pressure threshold interrupt disabled (reset value) <b>1</b> — Pressure threshold interrupt enabled
2	INT_EN_TTH	Interrupt enable. <b>0</b> — Temperature threshold interrupt disabled (reset value) <b>1</b> — Temperature threshold interrupt enabled
1	INT_EN_PCHG	Interrupt enable. <b>0</b> — Pressure change interrupt disabled (reset value) <b>1</b> — Pressure change interrupt enabled
0	INT_EN_TCHG	Interrupt enable. <b>0</b> — Temperature change interrupt disabled (reset value) <b>1</b> — Temperature change interrupt enabled

 Table 52. CTRL\_REG4 - interrupt enable register (address 29h) bit description...continued

# 14.22.5 CTRL\_REG5 - interrupt configuration register (address 2Ah)

Table 53.	CTRL_REG5	<ul> <li>interrupt cor</li> </ul>	nfiguration re	egister (addı	ress 2Ah) bit	allocation	

Bit	7	6	5	4	3	2	1	0
Symbol	INT_CFG_DRDY	INT_CFG_FIFO	INT_CFG_PW	INT_CFG_TW	INT_CFG_PTH	INT_CFG_TTH	INT_CFG_PCHG	INT_CFG_TCHG
Reset	0	0	0	0	0	0	0	0
Access	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W


#### Table 54. CTRL\_REG5 - interrupt configuration register (address 2Ah) bit description

Bit	Symbol	Description
7	INT_EN_DRDY	INT1/INT2 configuration. <b>0</b> — Interrupt is routed to INT2 pin (reset value) <b>1</b> — Interrupt is routed to INT1
6	INT_CFG_FIFO	INT1/INT2 configuration. <b>0</b> — Interrupt is routed to INT2 pin (reset value) <b>1</b> — Interrupt is routed to INT1
5	INT_CFG_PW	INT1/INT2 configuration. <b>0</b> — Interrupt is routed to INT2 pin (reset value) <b>1</b> — Interrupt is routed to INT1
4	INT_CFG_TW	INT1/INT2 configuration. <b>0</b> — Interrupt is routed to INT2 pin (reset value) <b>1</b> — Interrupt is routed to INT1

#### I<sup>2</sup>C precision pressure sensor with altimetry


Bit	Symbol	Description
3	INT_CFG_PTH	INT1/INT2 configuration. <b>0</b> — Interrupt is routed to INT2 pin (reset value) <b>1</b> — Interrupt is routed to INT1
2	INT_CFG_TTH	INT1/INT2 configuration. <b>0</b> — Interrupt is routed to INT2 pin (reset value) <b>1</b> — Interrupt is routed to INT1
1	INT_CFG_PCHG	INT1/INT2 configuration. <b>0</b> — Interrupt is routed to INT2 pin (reset value) <b>1</b> — Interrupt is routed to INT1
0	INT_CFG_TCHG	INT1/INT2 configuration. <b>0</b> — Interrupt is routed to INT2 pin (reset value) <b>1</b> — Interrupt is routed to INT1

#### Table 54. CTRL\_REG5 - interrupt configuration register (address 2Ah) bit description...continued

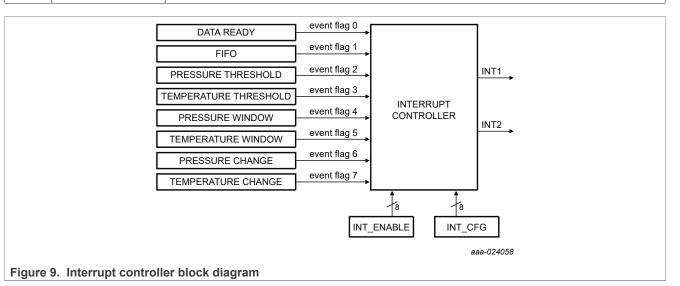

The system's interrupt controller uses the corresponding bit field in the CTRL\_REG5 register to determine the routing table for the INT1 and INT2 interrupt pins. If the bit value is logic '0' the functional block's interrupt is routed to INT2, and if the bit value is logic '1' then the interrupt is routed to INT1.

All interrupts routed to INT1 or INT2 are logically OR'd as illustrated in <u>Figure 10</u>. One or more functional blocks can assert an interrupt pin simultaneously, therefore a host application responding to an interrupt should read the INT\_SOURCE register to determine the appropriate sources of the interrupt.

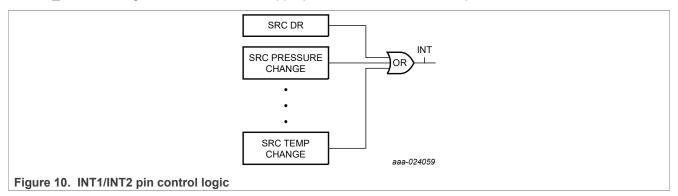

© 2024 NXP B.V. All rights reserved.

#### I<sup>2</sup>C precision pressure sensor with altimetry

#### 14.23 Offset correction registers

The 2's complement offset correction registers values are used to trim the temperature, altitude, and pressure offsets that might occur over the life of the product.

#### 14.23.1 OFF\_P - offset pressure correction register (address 2Bh)

Pressure user accessible offset trim value expressed as an 8-bit, 2's complement number. The user offset registers may be adjusted to enhance accuracy and optimize the system performance. Range is from -512 Pa to +508 Pa, 4 Pa/LSB.

Table 55. OFF\_P - offset correction register (address 2Bh) bit allocation

Bit	7	6	5	4	3	2	1	0
Symbol		OFF_P[7:0]						
Reset	0	0	0	0	0	0	0	0
Access	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W

#### 14.23.2 OFF\_T - offset temperature correction register (address 2Ch)

Temperature user accessible offset trim value expressed as an 8-bit, 2's complement number. The user offset registers may be adjusted to enhance accuracy and optimize the system performance. Range is from -8 °C to +7.9375 °C, 0.0625 °C/LSB.

Table 56. OFF	T - offset temperature	correction register	(address 2Ch) bit allocatio	on

Bit	7	6	5	4	3	2	1	0
Symbol		OFF_T[7:0]						
Reset	0	0	0	0	0	0	0	0
Access	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W

#### 14.23.3 OFF\_H - altitude data user offset register (address 2Dh)

Altitude data user offset register (OFF\_H) is expressed as a 2's complement number in meters. See <u>Section 9.1.3 "Pressure/altitude"</u>. The user offset register provides user adjustment to the vertical height of the altitude output. The range of values are from -128 meters to +127 meters.

Table 57. OFF\_H - altitude data user offset register (address 2Dh) bit allocation


	-		<b>J</b>	,	,			
Bit	7	6	5	4	3	2	1	0
Symbol		OFF_H[7:0]						
Reset	0	0	0	0	0	0	0	0
Access	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W

I<sup>2</sup>C precision pressure sensor with altimetry

### 15 Package information

#### 15.1 Package dimensions

This drawing is located at http://nxp.com/files/shared/doc/package\_info/98ASA00260D.pdf.

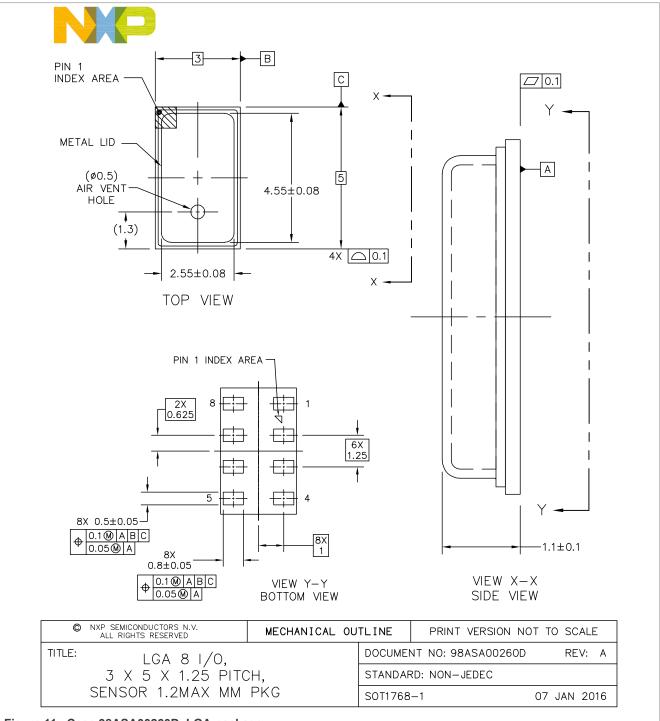



I<sup>2</sup>C precision pressure sensor with altimetry


NOTES:			
1. ALL DIMENSIONS IN MILLI	METERS.		
2. DIMENSIONING AND TOLER	ANCING PER ASME `	(14.5M-1	994
3. STYLE: PIN 1: VDD PIN 5: PIN 2: CAP PIN 6: PIN 3: GND PIN 7: PIN 4: VDDIO PIN 8:	INT1 SDA		
© NXP SEMICONDUCTORS N.V. ALL RIGHTS RESERVED	MECHANICAL OU	TLINE	PRINT VERSION NOT TO SCALE
TITLE: LGA 8 I/O,		DOCUMEN	NT NO: 98ASA00260D REV: A
3 X 5 X 1.25 PITC	-	STANDAR	D: NON-JEDEC
SENSOR 1.2MAX MM	PKG	SOT1768	-1 07 JAN 2016
Figure 12. Case 98ASA00260D, LGA packa	age notes		

I<sup>2</sup>C precision pressure sensor with altimetry


## 16 Soldering/landing pad information

The LGA package is compliant with the RoHS standard.


**Note:** Pin 1 index area marker does not have any internal electrical connections. Handling and soldering recommendations for pressure sensors are available in application notes AN1984 and AN3150.

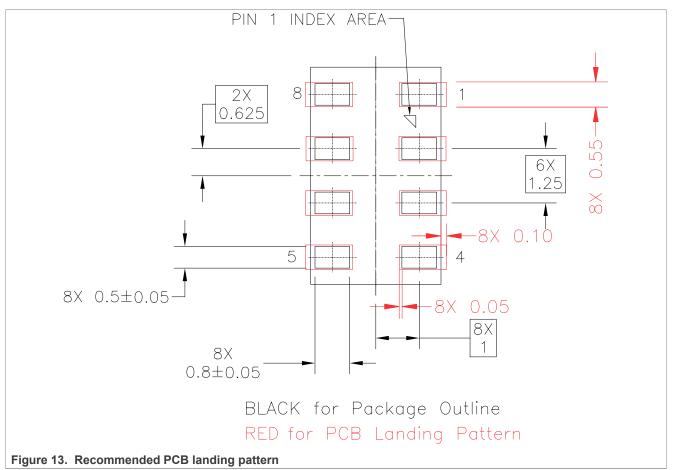


#### I<sup>2</sup>C precision pressure sensor with altimetry

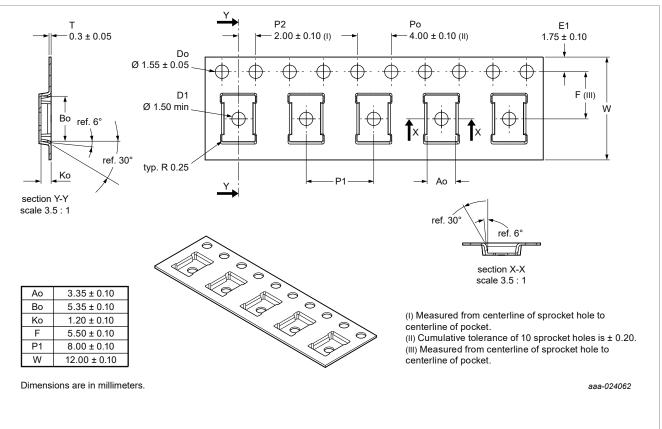

## 17 Tape and reel specifications



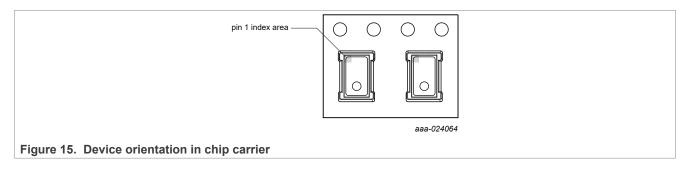

## 18 Related documentation

The device features and operations may be described in a variety of reference manuals, user guides, and application notes. To find the most-current versions of these documents:

- Go to the product page at <u>nxp.com/FXPQ3115BVS</u>.
- Click on the **Documentation** tab.

## I<sup>2</sup>C precision pressure sensor with altimetry

## **19 Revision history**

Table 58. Revision	history	
Document ID	Release date	Description
FXPQ3115BVS v.1.4	17 May 2024	<ul> <li>FXPQ3115BVS v.1.4 supercedes FXPQ3115BVS v.1.3.</li> <li>FXPQ3115BVS v.1.4 is a product data sheet.</li> <li>Updated the document formatting, revision history and legal information sections to comply with new NXP documentation guidelines.</li> <li><u>Section 17, Figure 14</u>, revised dimension "T" from "0.25 ± 0.05" to "0.3 ± 0.05".</li> </ul>
FXPQ3115BVS v.1.3	8 May 2023	<ul> <li>FXPQ3115BVS v.1.3 supercedes FXPQ3115BVS v.1.2.</li> <li>FXPQ3115BVS v.1.3 is a product data sheet.</li> <li>Updated the data sheet status from "Objective" to "Product".</li> </ul>
FXPQ3115BVS v.1.2	13 May 2022	<ul> <li>FXPQ3115BVS v.1.2 supercedes FXPQ3115BVS v.1.1.</li> <li>FXPQ3115BVS v.1.2 is an objective data sheet.</li> <li><u>Section 4, Table 1</u>, removed the row "FXPQ3115BVS" with "Tray" in the shipping column.</li> </ul>
FXPQ3115BVS v.1.1	18 April 2022	<ul> <li>FXPQ3115BVS v.1.1 supercedes FXPQ3115BVS v.1.</li> <li>FXPQ3115BVS v.1.1 is an objective data sheet.</li> <li><u>Section 9.4, Table 6</u>, revised the I<sup>2</sup>C address from "0x62" to "0x60" and revised the sentence in the row following from "Client address has been set to 62h or 110 0010. 8-bit read is C5h, 8-bit write is C4h." to "Client address has been set to 60h or 110 0000. 8-bit read is C1h, 8-bit write is C0h."</li> <li><u>Section 10.2</u>, revised the paragraph before Figure 4 from "The standard 7-bit I<sup>2</sup>C client address is 62h or 110 0010. 8-bit read is C5h, 8-bit write is C4h" to "The device uses 7-bit addressing and does not acknowledge general call address 000 0000. The standard 7-bit I<sup>2</sup>C client address is 60h or 110 0000. 8-bit read is C1h, 8-bit write is C0h."</li> <li><u>Section 14, Table 10</u>, inserted C5h as the reset value in the register address 0Ch (WHO_AM_I).</li> <li><u>Section 18</u>, Inserted document link to the FXPQ7115BVS product page.</li> </ul>
FXPQ3115BVS v.1	7 October 2021	<ul><li>FXPQ3115BVS v.1 is an objective data sheet.</li><li>Initial release.</li></ul>

#### I<sup>2</sup>C precision pressure sensor with altimetry

## Legal information

#### Data sheet status

Document status <sup>[1][2]</sup>	Product status <sup>[3]</sup>	Definition
Objective [short] data sheet	Development	This document contains data from the objective specification for product development.
Preliminary [short] data sheet	Qualification	This document contains data from the preliminary specification.
Product [short] data sheet	Production	This document contains the product specification.

[1] Please consult the most recently issued document before initiating or completing a design.

[2] The term 'short data sheet' is explained in section "Definitions".

[3] The product status of device(s) described in this document may have changed since this document was published and may differ in case of multiple devices. The latest product status information is available on the Internet at URL <u>https://www.nxp.com</u>.

#### Definitions

**Draft** — A draft status on a document indicates that the content is still under internal review and subject to formal approval, which may result in modifications or additions. NXP Semiconductors does not give any representations or warranties as to the accuracy or completeness of information included in a draft version of a document and shall have no liability for the consequences of use of such information.

Short data sheet — A short data sheet is an extract from a full data sheet with the same product type number(s) and title. A short data sheet is intended for quick reference only and should not be relied upon to contain detailed and full information. For detailed and full information see the relevant full data sheet, which is available on request via the local NXP Semiconductors sales office. In case of any inconsistency or conflict with the short data sheet, the full data sheet shall prevail.

**Product specification** — The information and data provided in a Product data sheet shall define the specification of the product as agreed between NXP Semiconductors and its customer, unless NXP Semiconductors and customer have explicitly agreed otherwise in writing. In no event however, shall an agreement be valid in which the NXP Semiconductors product is deemed to offer functions and qualities beyond those described in the Product data sheet.

### Disclaimers

Limited warranty and liability — Information in this document is believed to be accurate and reliable. However, NXP Semiconductors does not give any representations or warranties, expressed or implied, as to the accuracy or completeness of such information and shall have no liability for the consequences of use of such information. NXP Semiconductors takes no responsibility for the content in this document if provided by an information source outside of NXP Semiconductors.

In no event shall NXP Semiconductors be liable for any indirect, incidental, punitive, special or consequential damages (including - without limitation - lost profits, lost savings, business interruption, costs related to the removal or replacement of any products or rework charges) whether or not such damages are based on tort (including negligence), warranty, breach of contract or any other legal theory.

Notwithstanding any damages that customer might incur for any reason whatsoever, NXP Semiconductors' aggregate and cumulative liability towards customer for the products described herein shall be limited in accordance with the Terms and conditions of commercial sale of NXP Semiconductors.

**Right to make changes** — NXP Semiconductors reserves the right to make changes to information published in this document, including without limitation specifications and product descriptions, at any time and without notice. This document supersedes and replaces all information supplied prior to the publication hereof.

**Applications** — Applications that are described herein for any of these products are for illustrative purposes only. NXP Semiconductors makes no representation or warranty that such applications will be suitable for the specified use without further testing or modification.

Customers are responsible for the design and operation of their applications and products using NXP Semiconductors products, and NXP Semiconductors accepts no liability for any assistance with applications or customer product design. It is customer's sole responsibility to determine whether the NXP Semiconductors product is suitable and fit for the customer's applications and products planned, as well as for the planned application and use of customer's third party customer(s). Customers should provide appropriate design and operating safeguards to minimize the risks associated with their applications and products.

NXP Semiconductors does not accept any liability related to any default, damage, costs or problem which is based on any weakness or default in the customer's applications or products, or the application or use by customer's third party customer(s). Customer is responsible for doing all necessary testing for the customer's applications and products using NXP Semiconductors products in order to avoid a default of the applications and the products or of the application or use by customer's third party customer(s). NXP does not accept any liability in this respect.

Limiting values — Stress above one or more limiting values (as defined in the Absolute Maximum Ratings System of IEC 60134) will cause permanent damage to the device. Limiting values are stress ratings only and (proper) operation of the device at these or any other conditions above those given in the Recommended operating conditions section (if present) or the Characteristics sections of this document is not warranted. Constant or repeated exposure to limiting values will permanently and irreversibly affect the quality and reliability of the device.

Terms and conditions of commercial sale — NXP Semiconductors products are sold subject to the general terms and conditions of commercial sale, as published at https://www.nxp.com/profile/terms, unless otherwise agreed in a valid written individual agreement. In case an individual agreement is concluded only the terms and conditions of the respective agreement shall apply. NXP Semiconductors hereby expressly objects to applying the customer's general terms and conditions with regard to the purchase of NXP Semiconductors products by customer.

**No offer to sell or license** — Nothing in this document may be interpreted or construed as an offer to sell products that is open for acceptance or the grant, conveyance or implication of any license under any copyrights, patents or other industrial or intellectual property rights.

#### I<sup>2</sup>C precision pressure sensor with altimetry

Suitability for use in automotive applications - This NXP product has been qualified for use in automotive applications. If this product is used by customer in the development of, or for incorporation into, products or services (a) used in safety critical applications or (b) in which failure could lead to death, personal injury, or severe physical or environmental damage (such products and services hereinafter referred to as "Critical Applications"), then customer makes the ultimate design decisions regarding its products and is solely responsible for compliance with all legal, regulatory, safety, and security related requirements concerning its products, regardless of any information or support that may be provided by NXP. As such, customer assumes all risk related to use of any products in Critical Applications and NXP and its suppliers shall not be liable for any such use by customer. Accordingly, customer will indemnify and hold NXP harmless from any claims, liabilities, damages and associated costs and expenses (including attorneys' fees) that NXP may incur related to customer's incorporation of any product in a Critical Application.

**Quick reference data** — The Quick reference data is an extract of the product data given in the Limiting values and Characteristics sections of this document, and as such is not complete, exhaustive or legally binding.

**Export control** — This document as well as the item(s) described herein may be subject to export control regulations. Export might require a prior authorization from competent authorities.

**Translations** — A non-English (translated) version of a document, including the legal information in that document, is for reference only. The English version shall prevail in case of any discrepancy between the translated and English versions.

Security — Customer understands that all NXP products may be subject to unidentified vulnerabilities or may support established security standards or specifications with known limitations. Customer is responsible for the design and operation of its applications and products throughout their lifecycles to reduce the effect of these vulnerabilities on customer's applications and products. Customer's responsibility also extends to other open and/or proprietary technologies supported by NXP products for use in customer's applications. NXP accepts no liability for any vulnerability. Customer should regularly check security updates from NXP and follow up appropriately. Customer shall select products with security features that best meet rules,

regulations, and standards of the intended application and make the ultimate design decisions regarding its products and is solely responsible for compliance with all legal, regulatory, and security related requirements concerning its products, regardless of any information or support that may be provided by NXP.

NXP has a Product Security Incident Response Team (PSIRT) (reachable at <u>PSIRT@nxp.com</u>) that manages the investigation, reporting, and solution release to security vulnerabilities of NXP products.

 $\ensuremath{\mathsf{NXP}}\xspace{\mathsf{B.V.}}$  — NXP B.V. is not an operating company and it does not distribute or sell products.

#### Trademarks

Notice: All referenced brands, product names, service names, and trademarks are the property of their respective owners. **NXP** — wordmark and logo are trademarks of NXP B.V.

## I<sup>2</sup>C precision pressure sensor with altimetry

## Tables

Tab. 1. Tab. 2.	Ordering information Pin description		Tab. 32.	INT_SC register
Tab. 2. Tab. 3.	Maximum ratings		Tab. 33.	PT DA
Tab. 3. Tab. 4.	ESD and latchup protection characteristics		Tab. 55.	(addres
Tab. 4. Tab. 5.	Mechanical characteristics		Tab. 34.	PT DA
Tab. 5. Tab. 6.	Electrical characteristics		Tab. 54.	
Tab. 0. Tab. 7.	Serial interface pin descriptions		Tab. 35.	(addres
Tab. 7. Tab. 8.			Tap. 55.	BAR_IN
Tab. 8. Tab. 9.	I2C client timing values			pressur
Tab. 9. Tab. 10.	Mode of operation description		Tab 26	bit alloc
	Register address map	. 17	Tab. 36.	P_TGT
Tab. 11.	Register address map: Area A (F_Mode =	10		altitude
Tab 10	0, FIFO disabled)	. 19	Tab 27	17h) bit
Tab. 12.	Register address map: Area A (F_Mode >	10	Tab. 37.	T_TGT-
Tab 12	0, FIFO in circular buffer or full stop mode)	. 19	Tab 20	(addres
Tab. 13.	Alias for DR_Status (06h) or F_Status	20	Tab. 38.	P_WNE
Tab 11	(0Dh) registers	20		altitude
Tab. 14.	DR_STATUS - status register (address	20	Tab. 20	19h, 1A
Tab 15	06h) bit allocation	.20	Tab. 39.	T_WIN-
Tab. 15.	DR_STATUS - status register (address	20	T-6 40	(addres
T-1 40	06h) bit description	.20	Tab. 40.	P_MIN_
Tab. 16.	OUT_P_MSB, OUT_P_CSB, OUT_P_LSB			- minim
	- pressure and altitude data registers	00	T-1- 44	(addres
T 1 47	(address 01h, 02h, 03h) bit allocation	. 22	Tab. 41.	P_MAX
Tab. 17.	OUT_T_MSB, OUT_T_LSB - temperature			- maxim
	data registers (address 04h, 05h) bit	00	T 1 40	(addres
T 1 40		22	Tab. 42.	T_MIN_
Tab. 18.	OUT_P_DELTA_MSB, OUT_P_DELTA_			tempera
	CSB, OUT_P_DELTA_LSB - pressure and		<b>T</b> 1 10	allocatio
	altitude delta register (address 07h, 08h,	00	Tab. 43.	T_MAX
<b>T</b> 1 10	09h) bit allocation	.23		tempera
Tab. 19.	OUT_T_DELTA_MSB, OUT_T_DELTA_		<b>T</b> 1 4 4	allocatio
	LSB - temperature delta register (address		Tab. 44.	CTRL_I
	0Ah, 0Bh) bit allocation	.23		26h) bit
Tab. 20.	WHO_AM_I - device ID register (address		Tab. 45.	CTRL_I
<b>T</b> 1 04	0Ch) bit allocation	.23	<b>T</b> 1 10	26h) bit
Tab. 21.	F_STATUS - FIFO status register (address	~ .	Tab. 46.	System
	0Dh) bit allocation	. 24	Tab. 47.	CTRL_I
Tab. 22.	F_STATUS - FIFO status register (address	~ .		27h) bit
	0Dh) bit description	. 24	Tab. 48.	CTRL_I
Tab. 23.	F_STATUS - FIFO status register (address	~ .		27h) bit
	0Dh) bit description	.24	Tab. 49.	CTRL_I
Tab. 24.	F_DATA - FIFO data register (address 0Eh)			(addres
	bit allocation		Tab. 50.	CTRL_I
Tab. 25.	Read accesses through F_DATA	25		(addres
Tab. 26.	F_SETUP- FIFO setup register (address		Tab. 51.	CTRL_I
	0Fh) bit allocation	.25		(addres
Tab. 27.	F_SETUP- FIFO setup register (address		Tab. 52.	CTRL_I
	0Fh) bit description	26		(addres
Tab. 28.	TIME_DLY - time delay register (address		Tab. 53.	CTRL_I
	10h) bit allocation	.26		register
Tab. 29.	SYSMOD - system mode register (address		Tab. 54.	CTRL_I
	11h) bit allocation	. 26		register
Tab. 30.	SYSMOD - system mode register (address		Tab. 55.	OFF_P
	11h) bit description	.27		2Bh) bi
Tab. 31.	INT_SOURCE - system interrupt status		Tab. 56.	OFF_T
	register (address 12h) bit allocation	. 27		register
FXPQ3115BVS	All information provided in	this docume	ent is subject to lega	al disclaimers.

Tab. 32.	INT_SOURCE - system interrupt status
Tab. 33.	register (address 12h) bit description27 PT_DATA_CFG - sensor data register
140. 00.	(address13h) bit allocation
Tab. 34.	PT_DATA_CFG - sensor data register
	(address13h) bit description29
Tab. 35.	BAR_IN_MSB, BAR_IN_LSB - barometric
	pressure input register (address 14h, 15h) bit allocation
Tab. 36.	P_TGT_MSB, P_TGT_LSB - pressure/
	altitude target value register (address 16h,
	17h) bit allocation30
Tab. 37.	T_TGT- temperature target value register
Tab. 38.	(address 18h) bit allocation30 P_WND_LSB, P_WND_MSB - pressure/
Tab. 50.	altitude window value register (address
	19h, 1Ah) bit allocation
Tab. 39.	T_WIN- temperature window value register
	(address 1Bh) bit allocation30
Tab. 40.	P_MIN_MSB, P_MIN_CSB, P_MIN_LSB
	- minimum pressure or altitude register (address 1Ch, 1Dh, 1Eh) bit allocation
Tab. 41.	P MAX MSB, P MAX CSB, P MAX LSB
100. 41.	- maximum pressure or altitude register
	(address 21h, 22h, 23h) bit allocation
Tab. 42.	T_MIN_MSB, T_MIN_LSB - minimum
	temperature register (address 1Fh, 20h) bit
Tab. 43.	allocation
Tap. 43.	T_MAX_MSB, T_MAX_LSB - minimum temperature register (address 24h, 25h) bit
	allocation
Tab. 44.	CTRL_REG1 - control register 1 (address
	26h) bit allocation
Tab. 45.	CTRL_REG1 - control register 1 (address
Tab 16	26h) bit description
Tab. 46. Tab. 47.	System output sample rate selection
100. 47.	27h) bit allocation
Tab. 48.	CTRL_REG2 - control register 2 (address
	27h) bit description
Tab. 49.	CTRL_REG3 - interrupt CTRL register
Tab 50	(address 28h) bit allocation
Tab. 50.	CTRL_REG3 - interrupt CTRL register (address 28h) bit description
Tab. 51.	CTRL_REG4 - interrupt enable register
	(address 29h) bit allocation
Tab. 52.	CTRL_REG4 - interrupt enable register
T 1 50	(address 29h) bit description35
Tab. 53.	CTRL_REG5 - interrupt configuration
Tab. 54.	register (address 2Ah) bit allocation36 CTRL_REG5 - interrupt configuration
100. UT.	register (address 2Ah) bit description
Tab. 55.	OFF_P - offset correction register (address
	2Bh) bit allocation
Tab. 56.	OFF_T - offset temperature correction
	register (address 2Ch) bit allocation

© 2024 NXP B.V. All rights reserved.

### I<sup>2</sup>C precision pressure sensor with altimetry

 Tab. 58. Revision history ......43

## **Figures**

Fig. 1.	Block diagram	2
Fig. 2.	8-pin LGA pinout	3
Fig. 3.	Typical application diagram	4
Fig. 4.	I2C client timing diagram	11
Fig. 5.	I2C bus transmission signals	11
Fig. 6.	Mode transition diagram	12
Fig. 7.	Polling - no FIFO	13
Fig. 8.	Interrupt - no FIFO	14

Fig. 9.	Interrupt controller block diagram	.37
Fig. 10.	INT1/INT2 pin control logic	37
Fig. 11.	Case 98ASA00260D, LGA package	. 39
Fig. 12.	Case 98ASA00260D, LGA package notes	.40
Fig. 13.	Recommended PCB landing pattern	.41
Fig. 14.	LGA 3 mm × 5 mm embossed carrier tape	
	dimensions	. 42
Fig. 15.	Device orientation in chip carrier	.42

Rev. 1.4 — 17 May 2024

## I<sup>2</sup>C precision pressure sensor with altimetry

## Contents

1 2	General description1 Features and benefits1		STATUS 00h)
3	Applications		DR ST
4	Ordering information2		Data reg
5	Block diagram2		disabled
6	Pinning information3		OUT P
6.1	Pinning		- pressu
6.2	Pin description		(addres
7	System connections4		Data re
8	Handling and board mount	14.4	OUT_T
	recommendations4		data reg
8.1	Methods of handling4	14.5	OUT_P
8.2	Board mount recommendations4		CSB, O
9	Mechanical and electrical specifications5		altitude
9.1	Terminology5		09h)
9.1.1	Resolution5	14.6	OUT_T
9.1.2	Accuracy5		LSB - te
9.1.2.1	Offset 5		0Ah, 0E
9.1.2.2	Linearity5	14.7	WHO_A
9.1.2.3	Absolute pressure6		0Ch)
9.1.2.4	Span6	14.8	FIFO se
9.1.3	Pressure/altitude6		F_STAT
9.2	Absolute maximum ratings6		0Dh)
9.3	Mechanical characteristics7		F_DATA
9.4	Electrical characteristics8		F_SETI
10	Digital interface9		0Fh)
10.1	I2C characteristics9		TIME_C
10.2	I2C operation10		10h)
11	Modes of operation 12		SYSMC
11.1	OFF		11h)
11.2	STANDBY		INT_SC
11.3	ACTIVE		register
12	Quick start setup12		PT_DA
13	Functionality14		(addres
13.1	Factory calibration		BAR_IN
13.2	Barometer/altimeter function15		pressur
13.2.1	Barometric input		P_TGT
13.3	Temperature function15		altitude
13.4	Autonomous data acquisition15		17h)
13.5	FIFO		T_TGT-
13.6	External interrupts		(addres
13.6.1	Reach target threshold pressure/altitude	14.16	P_WND
10.00	(SRC_PTH)		altitude
13.6.2	Reach window target pressure/altitude	44 47	19h, 1A
1262	(SRC_PW)	14.17	T_WIN-
13.6.3	Reach target threshold temperature (SRC_	11 10	(addres
1264	TTH)	14.18	P_MIN_
13.6.4	Reach window target temperature (SRC_		- minim
13.6.5	TW)16 Pressure/altitude change (SRC_PCHG)17		(addres
13.6.6	Temperature change (SRC_TCHG)		P_MAX
13.6.7	Data ready		- maxim (addres
13.6.8	FIFO event		T_MIN
13.6.9	Pressure/altitude and temperature delta		tempera
13.6.10	Min/max data value storage		T MAX
13.0.10 14	Register descriptions		tempera
			•
FXPQ3115BVS	All information provided in this of	document is subject to le	egal disclaimers.

14.1	STATUS - sensor status register (address
14.2	00h)19 DR_STATUS - status register (address 06h) 20
14.2 14.2.1	
14.2.1	Data registers with F_MODE = 00 (FIFO
11 2	disabled)
14.3	OUT_P_MSB, OUT_P_CSB, OUT_P_LSB - pressure and altitude data registers
14.3.1	(address 01h, 02h, 03h)21 Data registers with F_MODE = 0022
14.3.1 14.4	
14.4	OUT_T_MSB, OUT_T_LSB - temperature
11 5	data registers (address 04h, 05h)22
14.5	OUT_P_DELTA_MSB, OUT_P_DELTA_ CSB, OUT_P_DELTA_LSB - pressure and
	altitude delta register (address 07h, 08h,
44.0	09h)
14.6	OUT_T_DELTA_MSB, OUT_T_DELTA_
	LSB - temperature delta register (address
4 4 7	0Ah, 0Bh)23
14.7	WHO_AM_I - device ID register (address
44.0	0Ch)
14.8	FIFO setup registers
14.8.1	F_STATUS - FIFO status register (address
	0Dh)
14.8.2	F_DATA - FIFO data register (address 0Eh) 24
14.8.3	F_SETUP- FIFO setup register (address
	0Fh)25
14.9	TIME_DLY - time delay register (address
	10h)26
14.10	SYSMOD - system mode register (address
	11h)26
14.11	INT_SOURCE - system interrupt status
	register (address 12h) 27
14.12	PT_DATA_CFG - sensor data register
	(address13h)28
14.13	BAR_IN_MSB, BAR_IN_LSB - barometric
	pressure input register (address 14h, 15h) 29
14.14	P_TGT_MSB, P_TGT_LSB - pressure/
	altitude target value register (address 16h,
	17h)29
14.15	T_TGT- temperature target value register
	(address 18h) 30
14.16	P_WND_LSB, P_WND_MSB - pressure/
	altitude window value register (address
	19h, 1Ah)
14.17	T_WIN- temperature window value register
	(address 1Bh)
14.18	P_MIN_MSB, P_MIN_CSB, P_MIN_LSB
	- minimum pressure or altitude register
	(address 1Ch, 1Dh, 1Eh)31
14.19	P MAX MSB, P MAX CSB, P MAX LSB
	- maximum pressure or altitude register
	(address 21h, 22h, 23h)
14.20	T_MIN_MSB, T_MIN_LSB - minimum
	temperature register (address 1Fh, 20h)
14.21	T_MAX_MSB, T_MAX_LSB - maximum
	temperature register (address 24h, 25h) 32

© 2024 NXP B.V. All rights reserved.

I<sup>2</sup>C precision pressure sensor with altimetry

44.00	O sustant us sisters	20
14.22	Control registers	32
14.22.1	CTRL_REG1 - control register 1 (address	~~~
44.00.0	=•··)	32
14.22.2	CTRL_REG2 - control register 2 (address	~ 4
	27h)	34
14.22.3	CTRL_REG3 - interrupt CTRL register	
	(address 28h)	34
14.22.4	CTRL_REG4 - interrupt enable register	
	(address 29h)	35
14.22.5	CTRL_REG5 - interrupt configuration	
	register (address 2Ah)	
14.23	Offset correction registers	38
14.23.1	OFF_P - offset pressure correction register	
	(address 2Bh)	38
14.23.2	OFF_T - offset temperature correction	
	register (address 2Ch)	38
14.23.3	OFF_H - altitude data user offset register	
	(address 2Dh)	38
15	Package information	39
15.1	Package dimensions	39
16	Soldering/landing pad information	41
17	Tape and reel specifications	42
18	Related documentation	
19	Revision history	43
	Legal information	
	-	

Please be aware that important notices concerning this document and the product(s) described herein, have been included in section 'Legal information'.

© 2024 NXP B.V.

All rights reserved.

For more information, please visit: https://www.nxp.com

Date of release: 17 May 2024 Document identifier: FXPQ3115BVS