

# SPECIFICATIONS FOR APPROVAL



Customer 聯發科技

Customer Part No.: \_\_\_\_\_ HELE. Part No: X2B026000B71HZ  
Application For: MT5931 Products: CRYSTAL  
Accepted Model: \_\_\_\_\_ Type & Freq.: HSX221SA / 26.000MHZ  
Sample Order No: EOS-B80063-1 Date: 2011/08/04

Approved By :

加高電子股份有限公司  
加高電子股份有限公司  
HARMONY ELECTRONICS CORP.

HARMONY ELECTRONICS (THAILAND) CO., LTD.

HARMONY ELECTRONICS (SHENZHEN) CORP., LTD.

**TAIPEI OFFICE:**

公司:(114)  
台北市內湖區堤頂大道2段409號2樓  
2F., NO.409, SEC.2, TIDING BLVD.,  
NEIHU DISTRICT, TAIPEI CITY 114,  
TAIWAN (R.O.C.)  
TEL:886-2-26588883  
FAX:886-2-26588683

**TAIWAN FACTORY:**

工廠:(831)  
高雄市大寮區大發工業區華東路39號  
No.39, Hua dong Rd., Daliao Dist.,Dafa  
Industrial Park., Kaohsiung City 831,  
Taiwan (R.O.C.)  
TEL: (07)787-1555-6  
FAX: (07)787-1557

**THAILAND FACTORY:**

66MOO 5, KAONGU-BEOKPRAI RD.,  
T.BEOKPRAI, A. BANPONG,  
RAJCHABUREE PROVINCE 70110,  
THAILAND  
TEL: (032)221994-6, 200740-1  
FAX: (032)200742

**SHENZHEN FACTORY:**

深圳市福永鎮塘尾村塘橋路聚源工業區  
QIAO TANG RD., TANGWEI VILLAGE  
FU YONG TOWN SHENZHEN CITY  
CHINA  
TEL: 0755-7309272 / 7309262  
FAX: 0755-7309755

Title <b>HSX221SA</b>				Country of origin		
QUARTZ CRYSTAL SPECIFICATION				<b>TAIWAN FACTORY</b>		
Date	Confirm	Check	Prepare	Spec. No.	Rev.	Page
<b>2011/08/04</b>	F. S. TSAI	C. L. WANG	U. F. CHEN	<b>X2B026000B71HZ</b>	0	1

HARMONY ELECTRONICS CORP.

# HSX221SA SPECIFICATION

## INDEX

ITEM	PAGE
1. QUARTZ CRYSTAL UNIT SPECIFICATION . . . . .	3
2. MARKING & DIMENSIONS . . . . .	4
3. INSIDE STRUCTURE . . . . .	5
4. EMBOSS CARRIER TAPE&REEL . . . . .	
a. DIMENSIONS OF CARRIER TAPE . . . . .	6
b. DIMENSIONS OF REEL . . . . .	6-7
c. STORAGE CONDITION . . . . .	7
d. STANDARD PACKING QUANTITY . . . . .	7
e. MATERIAL OF TAPE . . . . .	7
f. LABEL CONTENTS . . . . .	7
g. TAPING DIMENSION . . . . .	8
h. JOINT OF TAPE . . . . .	8
i. RELEASE STRENGHT OF COVER TAPE . . . . .	8
j. PACKAGE . . . . .	9
5. MECHANICAL ENDURANCE . . . . .	10
6. ENVIRONMENTAL ENDURANCE . . . . .	10
7. SUPPLEMENT . . . . .	11-12
8. Flow Chart . . . . .	13
9. Environmental Workload Chemical Substance Components List .	14



Title HSX221SA QUARTZ CRYSTAL SPECIFICATION				Country of origin <b>TAIWAN FACTORY</b>		
Date	Confirm	Check	Prepare	Spec. No.	Rev.	Page
2011/08/04	F. S. TSAI	C. L. WANG	U. F. CHEN	<b>X2B026000B71HZ</b>	0	2

# 1. QUARTZ CRYSTAL UNIT SPECIFICATION

- |                                |   |
|--------------------------------|---|
| 1. Frequency:                  | 26.000000MHz  |
| 2. Holder type :               | <b>HSX221SA</b>   |
| 3. Frequency tolerance:        | +/-7 ppm at 25deg.C +/-3deg.C   |
| 4. Equivalent resistance:      | 100 ohms Max. / SERIES  |
| 5. Storage temperature range:  | -40 deg.C To +85 deg.C  |
| 6. Operable temperature range: | -10 deg.C To +60 deg.C  |
| 7. Temperature drift:          | +/-10ppm                      -10 deg.C To +60deg.C                         |
| 8. Loading capacitance (CL) :  | 11.5 pF   |
| 9. Drive level:                | 10 $\mu$ W    (100uW Max)   |
| 10. Shunt Capacitance:         | 2.0 pF MAX  |
| 11. Insulation resistance :    | More than 500M ohms at DC 100V  |
| 12. Mode of oscillation:       | Fundamental   |
| 13. Circuit:                   | Measured in HP/E5100A,S&A 250B  |
| 14. Shocking :                 | Dropping from 50 cm height 3 times on firm wood                             |
| Variation :                    | Frequency less than +/-5 ppm<br>Resistance less than +/- 15 % or 2ohms max. |
| 15. Aging:                     | Less than +/- 1 ppm/Year  |
| 16. Holder                     | HSX221SA Seam type  |
| 17. Dimensions and marking     | Refer to page.4   |
| 18. Emboss carrier tape & reel | Refer to page.6 and page.7  |
| 19. Note:                      |   |

Title <b>HSX221SA</b>				Country of origin		
<b>QUARTZ CRYSTAL SPECIFICATION</b>				<b>TAIWAN FACTORY</b>		
Date	Confirm	Check	Prepare	Spec. No.	Rev.	Page
<b>2011/08/04</b>	F. S. TSAI	C. L. WANG	U. F. CHEN	<b>X2B026000B71HZ</b>	0	3

## 2. HSX221SA MARKING & DIMENSIONS

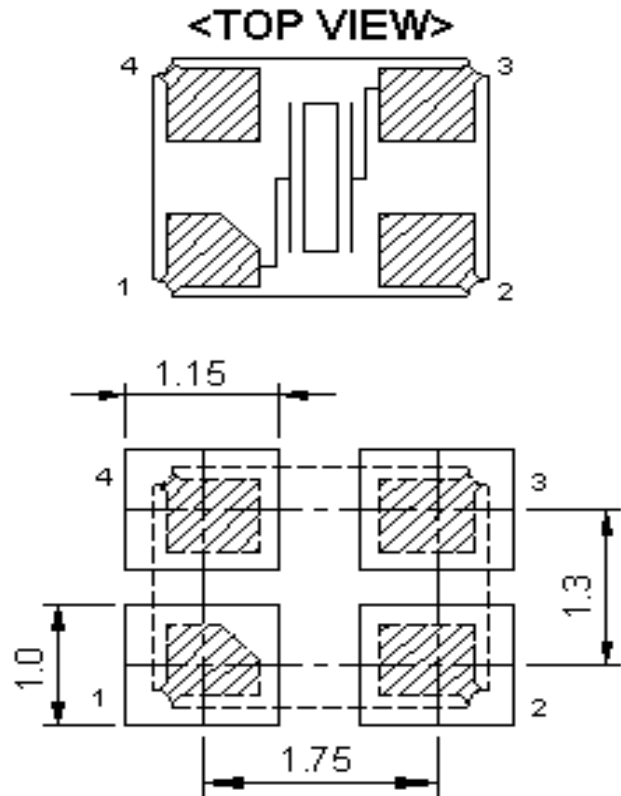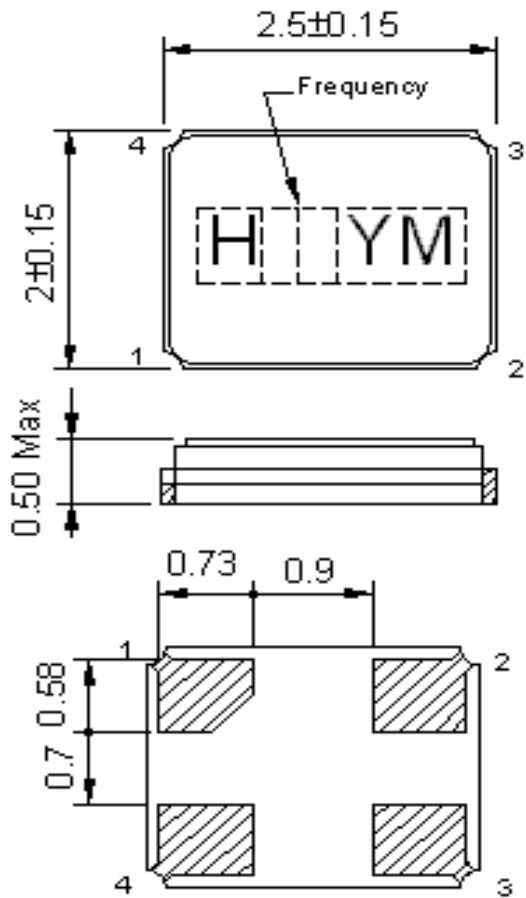

UNIT:mm  
TOLERANCE:±0.15

- \*Marking should be printed as following:  
Logo, Nominal Frequency, Manufactured year & month
- \*Nominal frequency = integer only  
( ex. 14.31818 MHz → 14 )
- \*Manufacturing Lot No.  
(Y: year) ex. 2000 shall be marked as ' 0 ' (As shown on the Table-1)  
(M: month) ex. June shall be marked as ' F ' (As shown on the Table-2).
- Marking : Laser marking.

(Table-1)

Year	2000	2001	2002	2003	2004	2005	2006	2007	2008	2009
	2010	2011	2012	2013	2014	2015	2016	2017	2018	2019
Code	0	1	2	3	4	5	6	7	8	9


(Table-2)

Jan.	Feb.	Mar.	Apr.	May.	Jun.	Jul.	Aug.	Sep.	Oct.	Nov.	Dec.
A	B	C	D	E	F	G	H	J	K	L	M

Title HSX221SA QUARTZ CRYSTAL SPECIFICATION				Country of origin TAIWAN FACTORY			
Date	Confirm	Check	Prepare	Spec. No.	Rev.	Page	
2011/08/04	F. S. TSAI	C. L. WANG	U. F. CHEN	X2B026000B71HZ	0	4	

HARMONY ELECTRONICS CORP.

### 3. INSIDE STRUCTURE

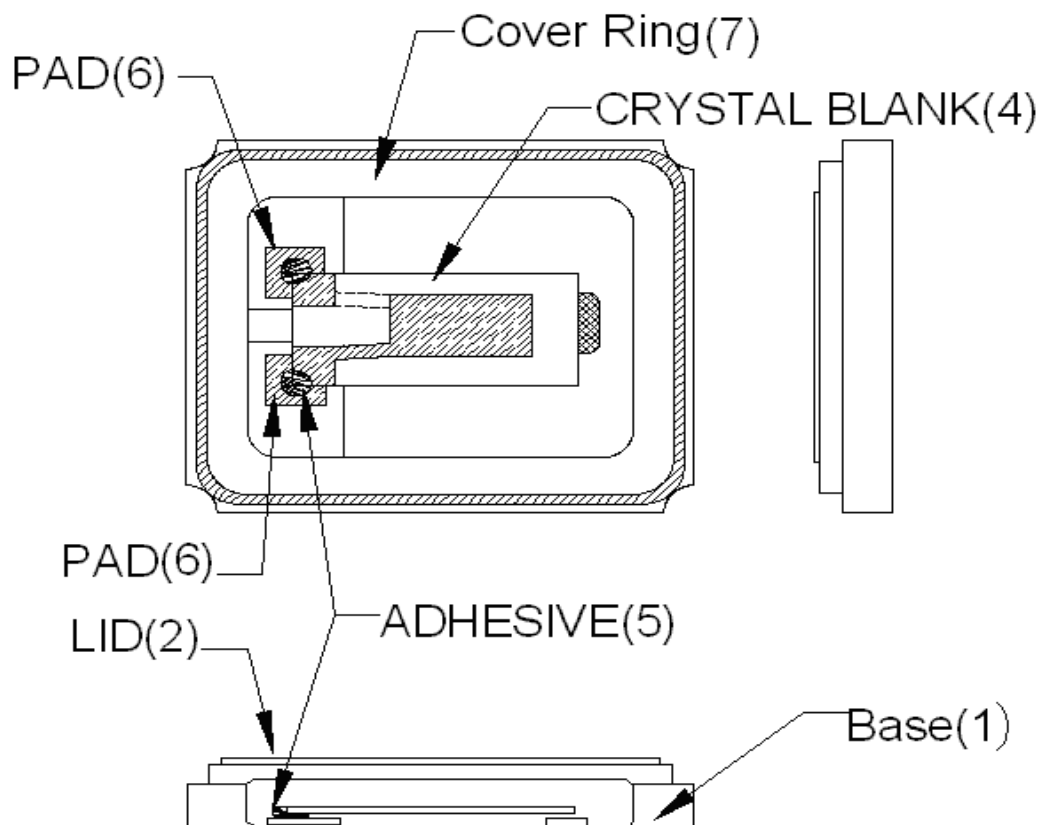

※Reference drawing


(1) Base: Alumina Ceramic ( $Al_2O_3$ ) Metallized Pad: W Ni Plating Au Plating
(2) Lid : Fe- Ni -Co
(3) Crystal Enclosure Seal: Seal Seam
(4) Crystal Blank Rectangular At-Cut Quartz Crystal Blank
(5) Adhesive Silver Conductive Silicon Resin
(6) PAD Alumina Ceramic (W. Ni. Au)
(7) Cover Ring : Fe-Ni-Co Alloy

The use prohibition chemistry substance of Table 1 of DHE-0204-1 (HE-QA-24) is not included in this item.

Title HSX221SA QUARTZ CRYSTAL SPECIFICATION				Country of origin <b>TAIWAN FACTORY</b>		
Date <b>2011/08/04</b>	Confirm F. S. TSAI	Check C. L. WANG	Prepare U. F. CHEN	Spec. No. <b>X2B026000B71HZ</b>	Rev. 0	Page 5


#### 4. HSX221SA EMBOSS CARRIER TAPE & REEL

##### a.) Dimensions of Carrier Tape

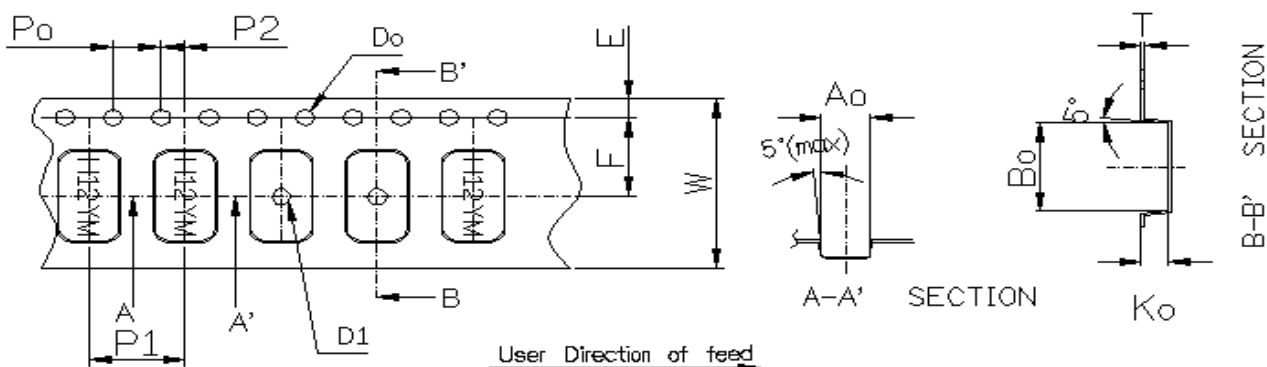

Symbol	<b>Ao</b>	<b>Bo</b>	<b>Ko</b>	<b>Po</b>	<b>P1</b>	<b>P2</b>
Spec	2.25±0.05	2.7±0.05	0.8±0.05	4.0±0.1	4.0±0.1	2.0±0.05
Symbol	<b>E</b>	<b>F</b>	<b>Do</b>	<b>D1</b>	<b>W</b>	<b>T</b>
Spec	1.75±0.1	3.5±0.05	∅1.55±0.05	∅1.1±0.1	8.0±0.2	0.25±0.05

##### b.) Dimensions of Reel

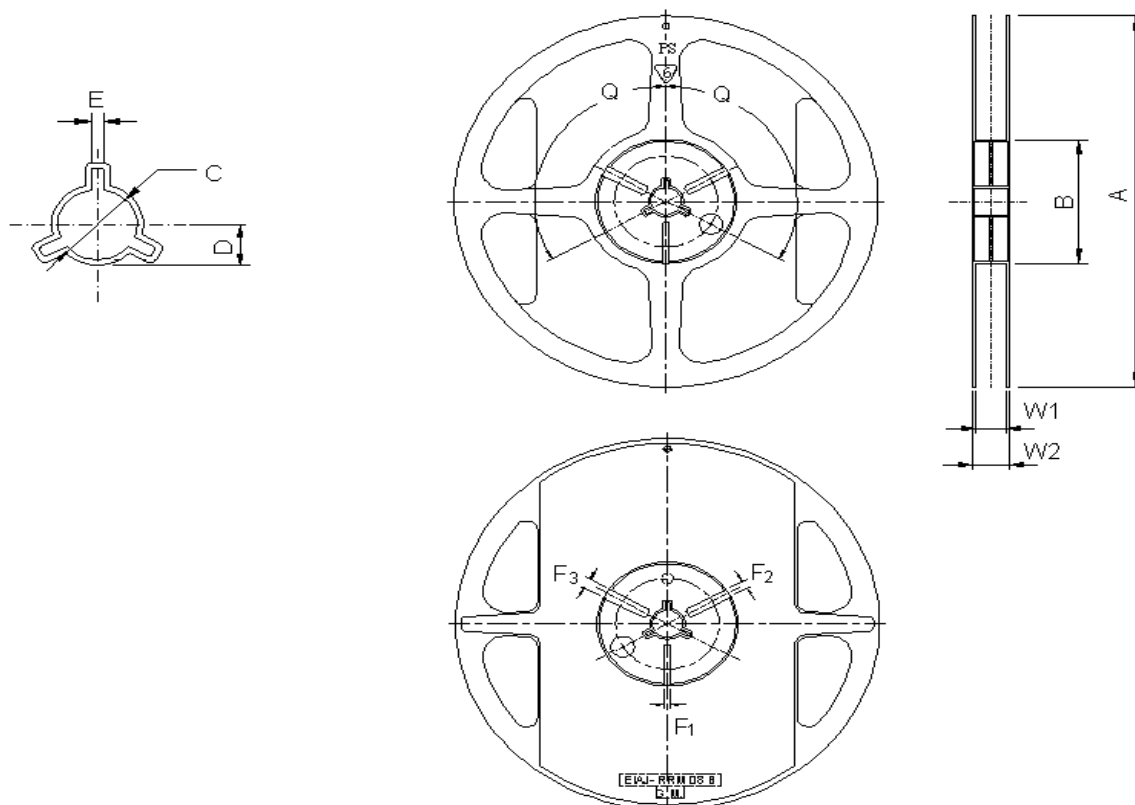

Title HSX221SA QUARTZ CRYSTAL SPECIFICATION				Country of origin <b>TAIWAN FACTORY</b>		
Date <b>2011/08/04</b>	Confirm F. S. TSAI	Check C. L. WANG	Prepare U. F. CHEN	Spec. No. <b>X2B026000B71HZ</b>	Rev. 0	Page 6

(Table-2)

(UNIT: mm)

ITEM		MARK	DIMENSIONS · ANGLE	
FLANCE	Diameter	A	$\phi$ 180+0/-3	
	Inner Width	W1	9.3+/-0.3	
	Outer Width	W2	11.3+/-1.0	
HUB	Out Line diameter		B	$\phi$ 60.5+/-0.5
	Center Core slit	Width	F1	3.0+0.5/-0
			F2	4.0+0.5/-0
		F3	5.0+0.5/-0	
	Position		q	120deg
	Spindle diameter		C	$\phi$ 13.2+/-0.5
Key Ditch	Width	E	3.0+/-0.2	

## c.) Storage condition

Temperature: +40deg.C Max.

Relative Humidity: 80% Max.


## d.) Standard packing quantity

3,000PCS / REEL

## e.) Material of the tape

Tape	Material
Carrier tape	PS Conductive
Top tape	Polyester

## f.) Label contents

	
TYPE:	
SPEC.No.:	
Parts No.:	
Lot No.:	
FREQ.:	MHz
Q'TY:	PCS
HARMONY ELECTRONICS CORP. (H.ELE.) HSF	


Sticks label for every reel.

Title HSX221SA QUARTZ CRYSTAL SPECIFICATION				Country of origin TAIWAN FACTORY		
Date	Confirm	Check	Prepare	Spec. No.	Rev.	Page
2011/08/04	F. S. TSAI	C. L. WANG	U. F. CHEN	X2B026000B71HZ	0	7

HARMONY ELECTRONICS CORP.

g.) Taping dimension

Leader	Cover-tape	The length of cover-tape in the leader is more than 400 mm including empty embossed area.
	Carrier-tape	After all products were packaged, must remain more than twenty pieces or 400 mm empty area, which should be sealed by cover-tape.
Terminal	Cover-tape	The tip of cover-tape shall be fixed temporary by paper tape and roll around the core of reel one round.
	Carrier-tape	The empty embossed area which are sealed by top cover-tape must remain more the 40 mm.

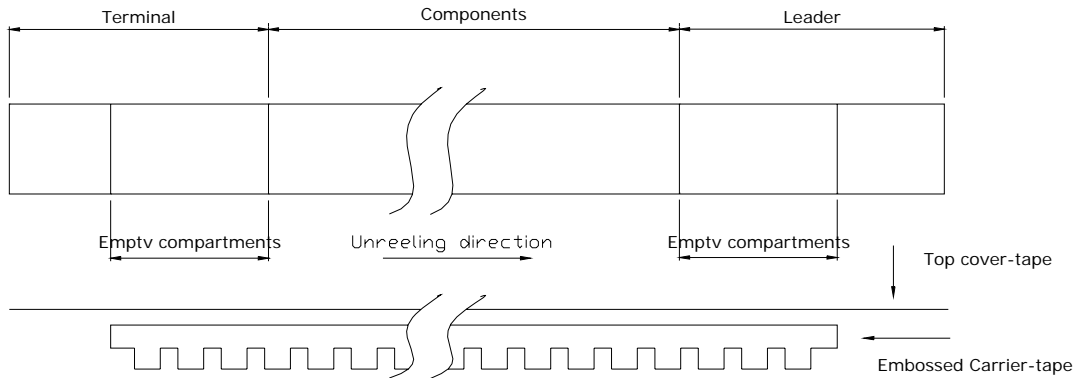

h.) Joint of tape

The carrier-tape and top cover-tape should not be jointed.


i.) Release strength of cover tape

It has to between 0.1N to 0.7N under following condition.

Pulling direction 165° to 180°

Speed 300mm/min.

Otherwise unless specified.

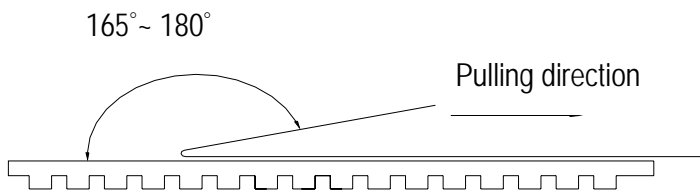


Other standards shall be based on JIS C 0806-1990.

Title HSX221SA QUARTZ CRYSTAL SPECIFICATION				Country of origin <b>TAIWAN FACTORY</b>		
Date <b>2011/08/04</b>	Confirm F. S. TSAI	Check C. L. WANG	Prepare U. F. CHEN	Spec. No. <b>X2B026000B71HZ</b>	Rev. 0	Page 8



j.) Package

1.Reel : $\varnothing$ 180

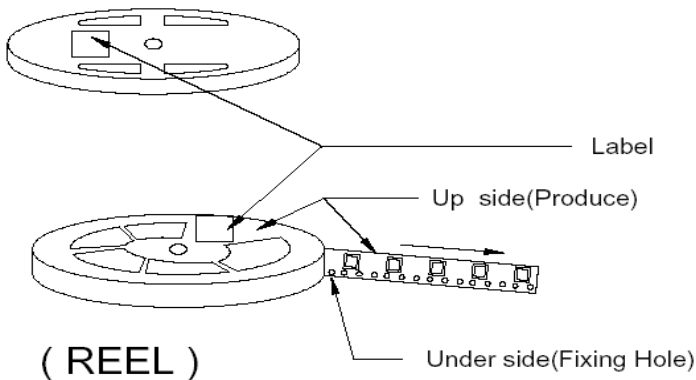

OR






Under side(Fixing Hole)

2. Carton

One reel quantity:[ 1000pcs] &[ 3000pcs]

- ①Use the cushion to fill up the contline in the Carton.
- ②Carton's Q'TY:1~20 pcs.
- ③Carton Type=A,B,C use two trigon pillar to fasten the Reel.
- ④Need to add 5 pages dry agent in each outer box.

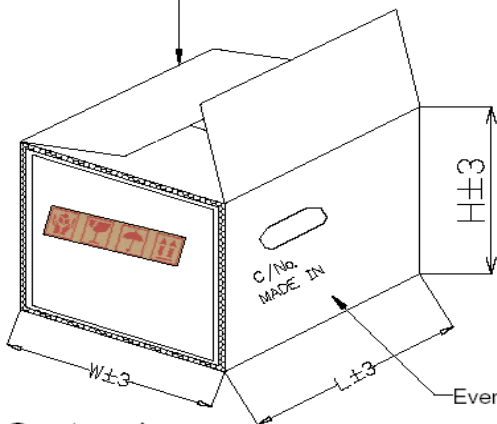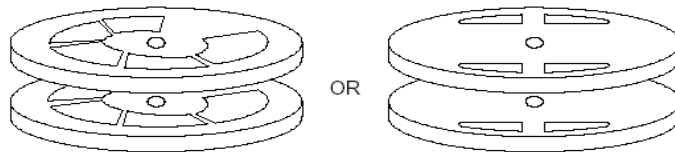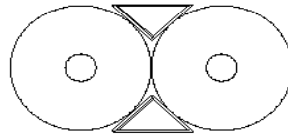

Carton Type	A	B	C	D
Produce Type	840/751	630/531/ 421	321/21	OTHER
Reel	10	10	20	1~7
L±3	360	360	360	195
W±3	195	195	195	195
H±3	140	120	120	150

Every Carton with 5 desiccant.

Title HSX221SA QUARTZ CRYSTAL SPECIFICATION				Country of origin <b>TAIWAN FACTORY</b>		
Date <b>2011/08/04</b>	Confirm F. S. TSAI	Check C. L. WANG	Prepare U. F. CHEN	Spec. No. <b>X2B026000B71HZ</b>	Rev. 0	Page 9

## 5. Mechanical Performance

Item		Test Methods	Specifications Code
1	Natural Drop	Drop 3 times from the height of 50cm onto min. 30mm thickness hard wooden board.	A
2	Vibration	Frequency 10-55Hz, Sine Wave full amplitude of 0.8mm to X, Y and Z 3 axes, Duration of 2 hours to each axis.	A
3	Sealing Tightness	Leak Rate $1.0 \times 10^{-8}$ Pa-m <sup>3</sup> /sec. Max. Measured by Helium leak detector. – Fine Leakage.	---
4	Solderability	After applying ROSIN Flux, dipping in solder bath at 245deg.C +/- 5deg.C for 3 +/- 0.5 sec.	B

## 6. Environment Performance

Item		Test Methods	Specifications Code
1	Humidity	Temperature 60°C +/- 2°C, RH 90~95%, Duration of 240 hours. Back to room temperature first, then in 1~2 hours, the component shall be checked.	A
2	Storage in Low Temperature	-40deg.C +/- 2deg.C, Duration of 240 hours. Back to the room temperature first, then in 1~2 hours, the component shall be checked.	A
3	Storage in High Temperature	+85deg.C +/- 2deg.C, Duration of 240 hours. Back to the room temperature first, then in 1~2 hours, the component shall be checked.	A
4	Temperature cycles	-40deg.C +/- 2deg.C (30min) ↔ +85deg.C +/- 2deg.C (30min) 25 cycles. Back to the room temperature first, then in 1~2 hours, the component shall be checked.	A

Specifications code	Specifications
A	Frequency variation shall be within +/-5ppm and equivalent resistance shall be within the specification after the test
B	More than 90% of lead shall be covered by new solder.


Title HSX221SA QUARTZ CRYSTAL SPECIFICATION				Country of origin <b>TAIWAN FACTORY</b>		
Date <b>2011/08/04</b>	Confirm F. S. TSAI	Check C. L. WANG	Prepare U. F. CHEN	Spec. No. <b>X2B026000B71HZ</b>	Rev. 0	Page 10

## 7. Supplement

### 7.1.Soldering


7.2.Please stay with our proposed reflow condition and do then soldering 2 times max.

### *Available for Lead Free Soldering*

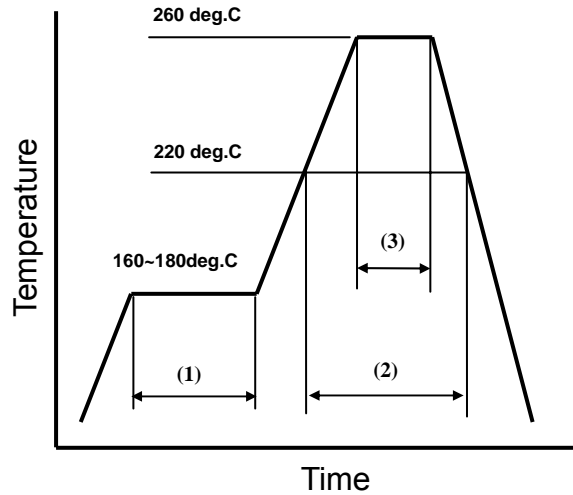

(1)	Preheat	160~180 deg.C	120sec.
(2)	Primary heat	220 deg.C	60sec.
(3)	Peak	260 deg.C	10sec. Max.

### 7.3.Land pattern layout(Example)

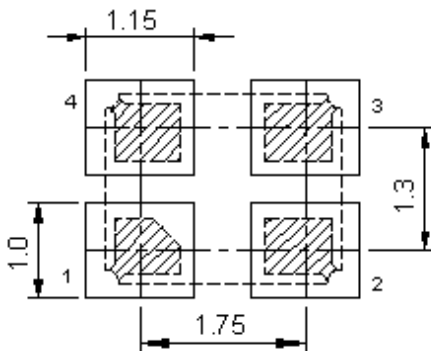

### 7.4.Solder iron (Example)

Bit temp.:350°C max.,Time:3sec max. ,Each terminal solder a 1 time max.

Title HSX221SA QUARTZ CRYSTAL SPECIFICATION				Country of origin <b>TAIWAN FACTORY</b>		
Date <b>2011/08/04</b>	Confirm F. S. TSAI	Check C. L. WANG	Prepare U. F. CHEN	Spec. No. <b>X2B026000B71HZ</b>	Rev. 0	Page 11

### 7.5.Mounting

This component is designed for automatic insertion.

However, you are requested to do the trial with your insertion machine in order to be sure of proper operation and no damage of component.

Please pay attention to board warp which may damage the component and cause Soldering Process.

### 7.6.Cleaning

Cleaning liquid which corrodes Nickel shall not be used

It may cause the problem on the surface, color, marking etc.

Ultra-sonic cleaning is possible, however, you are requested to check on your board.


Because we only checked as single unit.

### 7.7.Storage

Please keep away from high temperature and high humidity ,which may cause put solderbility. No direct Sunlight, No dew as well.

Title <b>HSX221SA</b> <b>QUARTZ CRYSTAL SPECIFICATION</b>				Country of origin <b>TAIWAN FACTORY</b>		
Date	Confirm	Check	Prepare	Spec. No.	Rev.	Page
<b>2011/08/04</b>	F. S. TSAI	C. L. WANG	U. F. CHEN	<b>X2B026000B71HZ</b>	0	12

### 8. Flow Chart

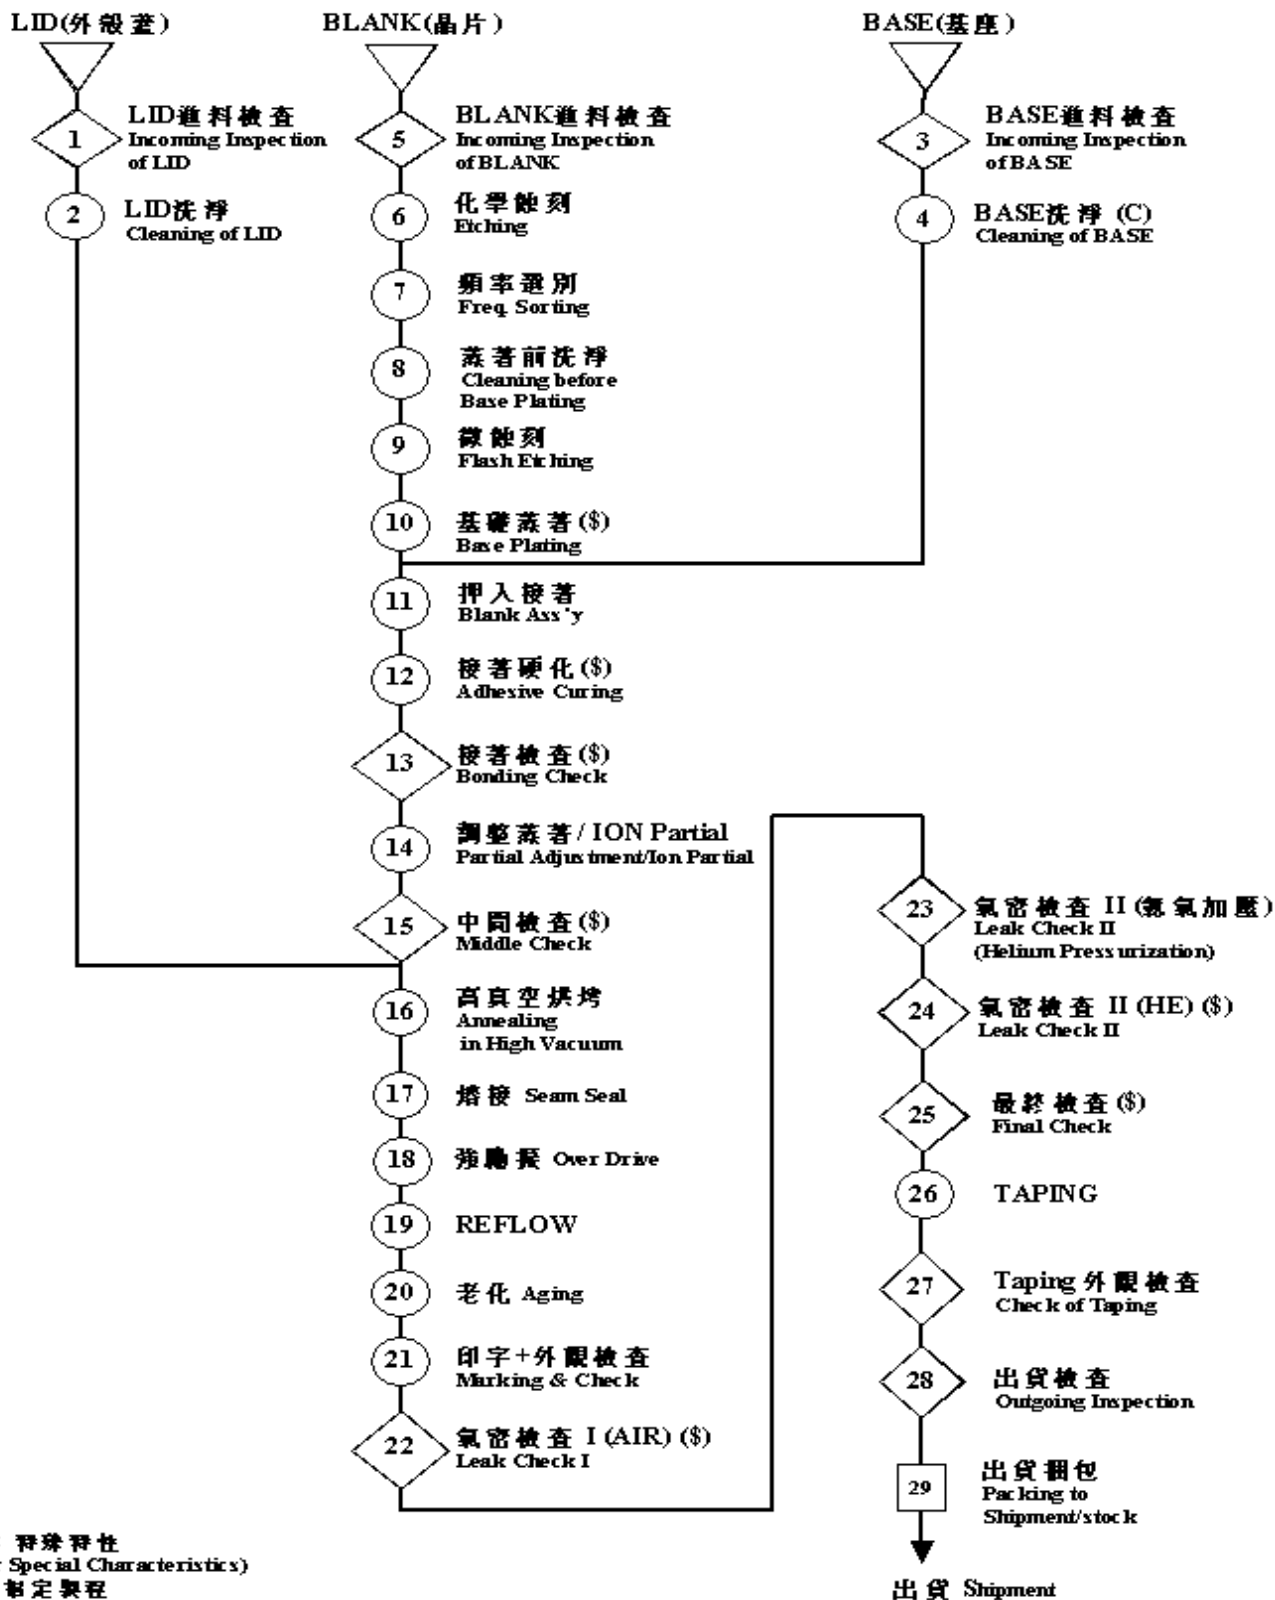

Title HSX221SA QUARTZ CRYSTAL SPECIFICATION				Country of origin <b>TAIWAN FACTORY</b>		
Date	Confirm	Check	Prepare	Spec. No.	Rev.	Page
2011/08/04	F. S. TSAI	C. L. WANG	U. F. CHEN	<b>X2B026000B71HZ</b>	0	13

9. Environmental Workload Chemical Substance Components List

Environmental Workload Chemical Substance Components List		
Chemical Substance Components	TYPE	HSX221S
	PERCENTAGE	
	9.6(mg)	ppm
Si	0.316800	30.412800
Au	0.048000	4.608000
Co & Co Compound	0.784320	75.294720
Mo & Mo Compound	0.017280	1.658880
Ag	1.875840	180.080640
Cu	0.075840	7.280640
Cr & Cr Compound	0.024000	2.304000
Al	2.083200	199.987200
Mn & Mn Compound	0.014400	1.382400
W & W Compound	0.042240	4.055040
Ni & Ni Compound	2.090880	200.724480
Fe	2.220480	213.166080

Title HSX221SA QUARTZ CRYSTAL SPECIFICATION				Country of origin <b>TAIWAN FACTORY</b>		
Date	Confirm	Check	Prepare	Spec. No.	Rev.	Page
2011/08/04	F. S. TSAI	C. L. WANG	U. F. CHEN	<b>X2B026000B71HZ</b>	0	14



EXCEL EXPORT PRINTOUT FORMAT

Run Name:

Run Date : 04-08-2011 11:32 am

S&A 250B: 12.01 Report: 4.62

Description: EOS-B80063-1

Reference Fr: 26000000 (Using Measured FL)

Power: 10.00 uW Into 20.0 ohms

PL: No Load CL: 11.50 pF

Crystal	First Failure	FR Hz	FL Hz	FL ppm	RR Ohms	C0 pF	C1 fF	C0/C1	L mH	Q k	TS ppm/pF	RLD2 Ohms	DLD2 Ohms	FDDL ppm
High Limit					100	2.00								
Low Limit														
1	PASS	25996206	25999746	-9.76	21.59	0.96	3.38	285.37	11.09	83.93	10.88	21.59	0.37	0.65
2	PASS	25996380	25999764	-9.08	12.77	0.95	3.20	296.92	11.71	149.73	10.33	12.65	0.27	1.09
3	PASS	25996274	25999788	-8.15	17.35	0.95	3.32	285.06	11.28	106.16	10.72	17.27	0.24	0.81
4	PASS	25996226	25999768	-8.94	24.52	0.95	3.35	284.97	11.19	74.54	10.80	24.49	0.42	0.61
5	PASS	25996237	25999747	-9.75	18.35	0.98	3.33	293.35	11.24	100.09	10.71	18.27	0.25	0.78
6	PASS	25996573	26000013	0.51	18.83	0.93	3.25	287.16	11.54	100.11	10.51	18.76	0.25	0.82
7	PASS	25996475	25999984	-0.60	21.06	0.94	3.32	284.89	11.30	87.68	10.71	21.00	0.17	0.66
8	PASS	25996508	25999983	-0.67	23.44	1.01	3.31	306.15	11.33	78.92	10.57	23.39	0.30	0.64
9	PASS	25996538	25999977	-0.87	18.37	0.93	3.25	286.31	11.54	102.61	10.51	18.30	0.27	0.81
10	PASS	25996509	25999976	-0.92	15.97	0.97	3.29	295.33	11.41	116.72	10.56	15.87	0.20	0.88
11	PASS	25996663	26000196	7.54	19.97	0.95	3.34	283.24	11.22	91.77	10.78	20.10	0.69	0.75
12	PASS	25996539	26000193	7.43	15.90	1.02	3.48	292.93	10.77	110.61	11.10	15.82	0.21	0.82
13	PASS	25996646	26000227	8.73	24.60	0.95	3.38	281.13	11.09	73.68	10.90	26.02	2.10	1.39
14	PASS	25996752	26000209	8.04	22.11	0.94	3.28	286.25	11.43	84.45	10.60	22.05	0.19	0.65
15	PASS	25996745	26000209	8.03	16.54	0.93	3.27	285.16	11.46	113.16	10.58	16.46	0.17	0.82

MAX	25996752	26000227	8.73	24.60	1.02	3.48	306.15	11.71	149.73	11.10	26.02	2.10	1.39
MIN	25996206	25999746	-9.76	12.77	0.93	3.20	281.13	10.77	73.68	10.33	12.65	0.17	0.61
X-bar	25996485	25999985	-0.56	19.42	0.96	3.32	288.95	11.31	98.28	10.68	19.47	0.41	0.81
3S	552	565	21.73	10.38	0.08	0.20	19.99	0.68	59.70	0.58	10.98	1.46	0.60