

Surge arrester

2-Electrode arrester

Series/Type: DG401A

Customer:

Version/Date: Issue 02/2015-9-9



Surge arrester 2-Electrode arrester DG401A

Features	Applications		
 Extremely small size 	Splitter		
 Extremely fast response time 	PCI Cards		
 Eexcllent SMD handing 	Morden		
Stable performance over life	Line cards		
 Very low capacitance 			
High insulation resistance			
 RoHS-compatible 			
UL-identification, No:E311500			
Electrical specifications		1	
DC breakdown voltage ^{2) 3)}		400	V
——Circuit current less than 2mA		±20	%
Impulse breakdown voltage 1)			
at 1kv/us -Typical values of distribution		≤900	V
Insulation resistance at DC 100V		≥1	GΩ
Capacitance at 1MHz 2)		≤1	Pf
Service life ²⁾			
10 operations 8/20	us	1	KA
10 operations 50Hz	50Hz		A
Weight		~1	g
Storage and operations temperature		-40+90	°C
Climatic category (GB/T 9043, IEC61643-1)		40/90/21	
Marking,Red positive		Without	





Tel: +86-510-81707285 Fax: +86-510-81707277

www.jsdgme.com


DC Elec. Issue 02/2015-9-9



Surge arrester

2-Electrode arrester DG401A

DC breakdown voltage

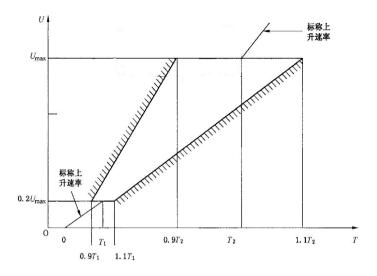

8/20us, Test wave

T1=1.25T=8us±20%

T2=20us±20%

10/700us, Test Wave


T1=1.67T=10us±20%

T2=700us±20%


10/1000us, Test Wave

T1=1.67T=10us±20%

T2=1000us±20%

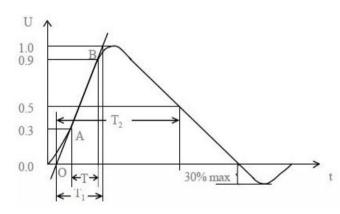

Recommended wave slodering profile

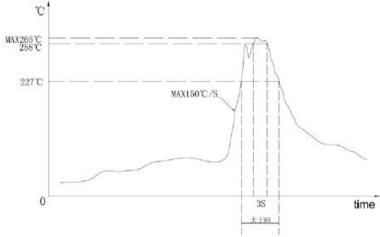

DC Elec. Issue 02/2015-9-9




Surge arrester

2-Electrode arrester DG401A

- 1) Sampling size in accordance to AQL(C=0)
- 2) DC spark-over voltage ±30% after load
- 3) Tests according to ITU-T Rec. K. 12 and IEC61643-1


Dimensions

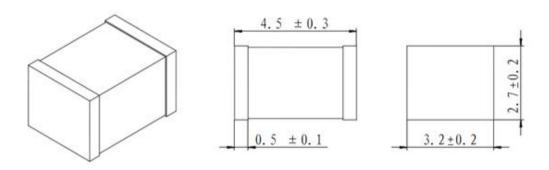

Wire Tin-plated

Packaging

One reel with 3000pcs

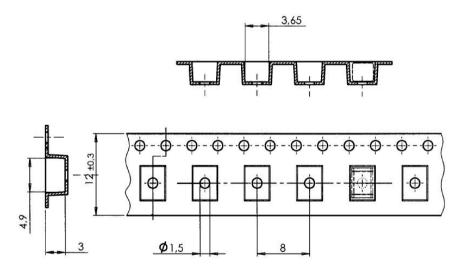

Cautions and warnings

- Surge arresters must not be operated directly in power supply networks
- Surge arresters may become hot in case of longer periods of current stress (danger of burning).
- If the contacts of the surge arrester are defective, current stress can lead to the formation of sparks and loud noises.
- Surge arresters may be used only within their specified values. In case of overload, the head contacts may fail or the component may be destroyed.
- Damaged surge arresters must not be re-used.

DC Elec. Issue 02/2015-9-9